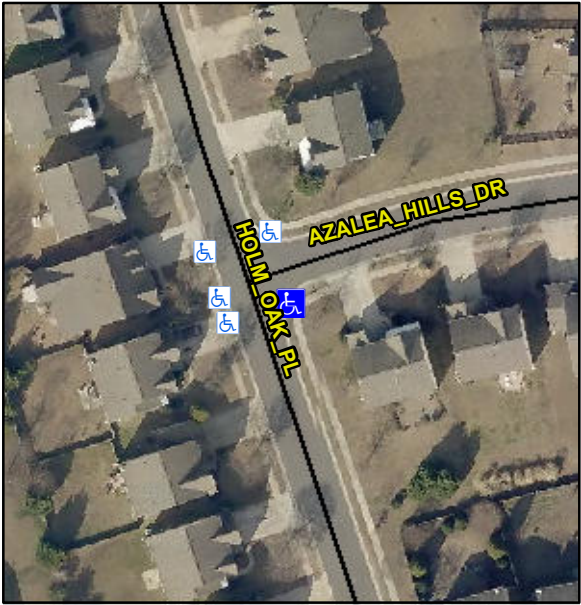


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46818	Main Street: HOLM_OAK_PL	Cross Street: AZALEA_HILLS_DR	Location: SE
ADA ID: 444189A4207D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	46.5
			Yes	Ramp Width (in)	51.5
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
Surveyor Notes: N/A PROW/ADA: R304.2.2, R304.5.3			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
Total Cost: \$ 3200.00			No	Painted X Walk2?	No
			N/A	X Walk 1 Direction	To N
			N/A	X Walk 2 Direction	To W
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 2 Width (in)	N/A
			9.1	X Walk 1 Slope (%)	6.6
			1.2	X Walk 2 Slope (%)	3.6
			N/A	X Walk 1 X Slope (%)	3.6
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			3.2	Road Slope (%)	N/A
			11.1	Road X Slope (%)	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	N/A
			N/A	Obstruction Type	N/A
			N/A	Obstruction Type	N/A
			Yes	Surface Condition? (G/P)	Good

