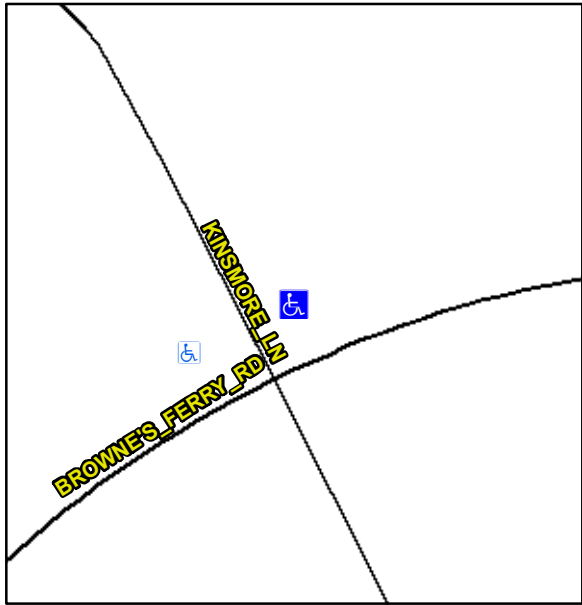


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                       |                                |                           |                        |                       |
|-----------------------|--------------------------------|---------------------------|------------------------|-----------------------|
| Intersection ID: 3829 | Main Street: BROWNE'S_FERRY_RD | Cross Street: KINSMORE_LN | Location:              | N                     |
| ADA ID: 449B0EC010E9  | Ramp Type: Directional1        | Initial Pass/Fail: Fail   | Overall Compliance: No | Severity Score: 13.75 |

| Codes/Mitigation Info/Possible Solution   |                               |            | Field Measurements/Component Compliance |                       |       |            |                             |      |
|---|-------------------------------|------------|---|-----------------------|-------|------------|-----------------------------|------|
|  <div>Street 1 Name<div>KINSMORE LN</div></div> <div>Stop Condition-Street 1<div>StopSign</div></div> <div>Street 2 Name<div>N/A</div></div> <div>Stop Condition-Street 2<div>N/A</div></div> | Possible Solutions:           |            | Compliance                              | Description           | Data  | Compliance | Description                 | Data |
|   | Remove & Replace Entire Ramp. |            | N/A                                     | Ramp Length (in)      | 73.0  | N/A        | Grade Break?                | N/A  |
|   |                               |            | Yes                                     | Ramp Width (in)       | 49.5  | N/A        | Grade Break Slope (%)       | 0.0  |
|   |                               |            | No                                      | Ramp Slope (%)        | 10.6  | N/A        | Grade Break XSlope (%)      | 0.0  |
|   |                               |            | No                                      | Ramp XSlope (%)       | 3.1   |            |                             |      |
|   |                               |            | N/A                                     | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
|   |                               |            | N/A                                     | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | 0.0  |
|   |                               |            | N/A                                     | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
|   | Surveyor Notes:               |            | N/A                                     | Landing Length (in)   | 0.0   | N/A        | DWS Provided?               | N/A  |
|   | N/A                           |            | N/A                                     | Landing Width (in)    | 0.0   | N/A        | DWS Contrast?               | N/A  |
|   |                               |            | N/A                                     | Landing Slope (%)     | 0.0   | N/A        | DWS Length (in)             | N/A  |
|   |                               |            | N/A                                     | Landing X Slope (%)   | 0.0   | N/A        | DWS Full Width?             | N/A  |
|   | PROW/ADA:                     |            | N/A                                     | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset LT (in)          | N/A  |
|   | R304.2.2, R304.5.3            |            | N/A                                     | Shared Landing?       | N/A   | N/A        | DWS Offset RT (in)          | N/A  |
|   |                               |            | N/A                                     | Gutter Ponding?       | 0.0   | N/A        | Gutter Slope (%)            | N/A  |
|   |                               |            | N/A                                     | Gutter Lip Ht (in)    | 0.0   | N/A        | Gutter X Slope (%)          | N/A  |
|   |                               |            | N/A                                     | Painted X Walk1?      | No    |            | Road Slope (%)              | 1.0  |
|   |                               |            |   | X Walk 1 Direction    | To SW |            | Road X Slope (%)            | 11.1 |
|   |                               |            |   | X Walk 1 Width (in)   | N/A   |            | Clear Space?                | N/A  |
|   |                               |            |   | X Walk 1 Slope (%)    | 1.0   | N/A        | Clear Space to XWalk (in)   | N/A  |
|   |                               |            |   | X Walk 1 X Slope (%)  | 11.1  | N/A        | Storm Grate/Utility Hazard? | N/A  |
|   |                               |            | N/A                                     | Ramp inside XWalk1?   | N/A   |            | Storm Grate/Utility Type    |      |
|   |                               |            | N/A                                     | Any Obstructions?     | N/A   |            |                             | N/A  |
|   |                               |            |   | Obstruction Type      |       | Yes        | Surface Condition? (G/P)    | Good |
|   |                               |            |   |                       |       | N/A        | Curb Slope (%)              | 17.8 |
| Total Cost:   |                               | \$ 1600.00 |   |                       |       |            |                             |      |

