

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15984	Main Street: LANIER_AV	Cross Street: UNAKA_AV	Location: SW
ADA ID: 44B18643D8F2	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

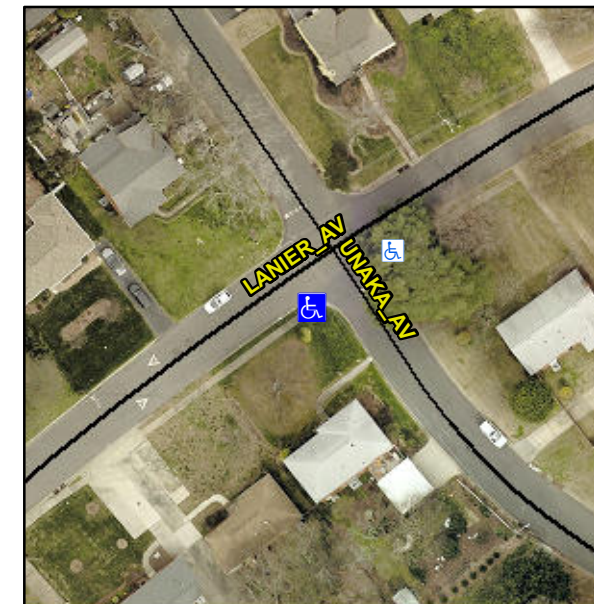

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R305.1.4, R305.2,
R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	40.5	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	48.0	Yes	Grade Break Slope (%)	2.9
Yes	Ramp Slope (%)	2.2	No	Grade Break XSlope (%)	3.6
Yes	Ramp XSlope (%)	1.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	68.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	18.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	4.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.2
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	No		Road Slope (%)	9.4
	X Walk 1 Direction	To NE		Road X Slope (%)	2.6
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	9.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.6	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	11.6

Total Cost: \$ 2350.00

