


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48557	Main Street: RIDGEFOREST_DR	Cross Street: ARDREY_WOODS_DR	Location: SE
ADA ID: 44B5C97BDA81	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

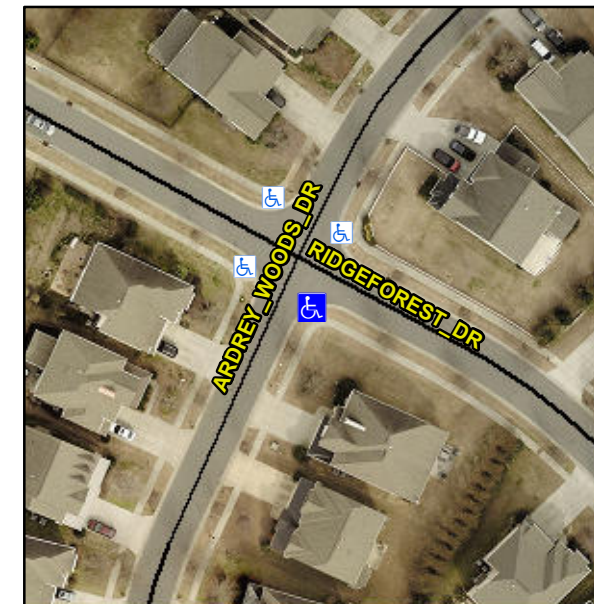

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	68.0	Yes	BlendTrans Slope (%)	3.1
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	6.4	N/A	Flare Slope RT (%)	6.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	45.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	11.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	2.0
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	1.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.0		Clear Space?	Yes
	Road X Slope (%)	3.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	12.2

Street 1 Name RIDGEFOREST DR
 Stop Condition-Street 1 StopSign
 Street 2 Name ARDREY WOODS DR
 Stop Condition-Street 2 None

