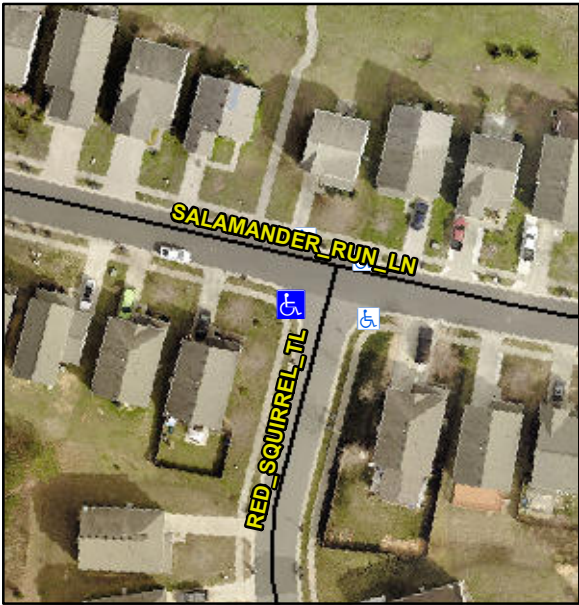


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48569	Main Street: RED_SQUIRREL_TL	Cross Street: SALAMANDER_RUN_LN	Location: SW
ADA ID: 45079122C981	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 12.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	46.0	Yes	Ramp Slope (%)	7.8
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.8
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	2.4	Yes	Flare Slope RT (%)	5.4
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	47.5	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	65.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.5
			No	Landing X Slope (%)	5.8	Yes	DWS Full Width?	Yes
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
PROW/ADA:		Not Found, R304.5.3, R304.2.1, R305.2, R302.7, R302.7.2, R304.5.4	N/A	Shared Landing?	No			
			No	Gutter Ponding?	Yes	No	Gutter Slope (%)	12.5
			No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.0
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To E		X Walk 2 Direction	To N
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	0.8
				X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	2.8
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	2.9	N/A	Clear Space?	Yes
				Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good

