


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 24374	Main Street: BEVERLY_CREST_BV	Cross Street: HUGH_FOREST_RD	Location: W
ADA ID: 450C5BB6AA3E	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 22.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

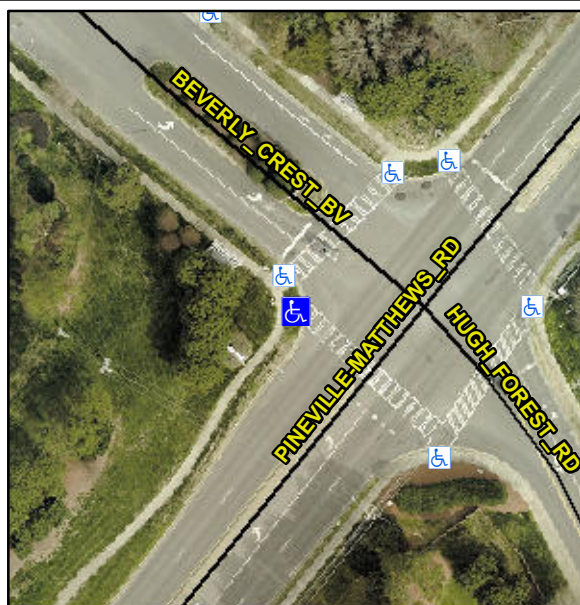

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.3, R305.1.4,
R305.2, R302.7.2, R304.5.4**

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	8.0
Yes	Ramp Width (in)	72.0	No	Ramp XSlope (%)	3.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.0	Yes	Flare Slope RT (%)	1.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.1	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	2.9	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.9
No	Gutter Lip Ht (in)	2.0	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

