


Intersection ID: 45793	Main Street: WINDING_RIVER_DR	Cross Street: GRANITE_TRAIL_LN	Location:	NE
ADA ID: 455BE9C13D69	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

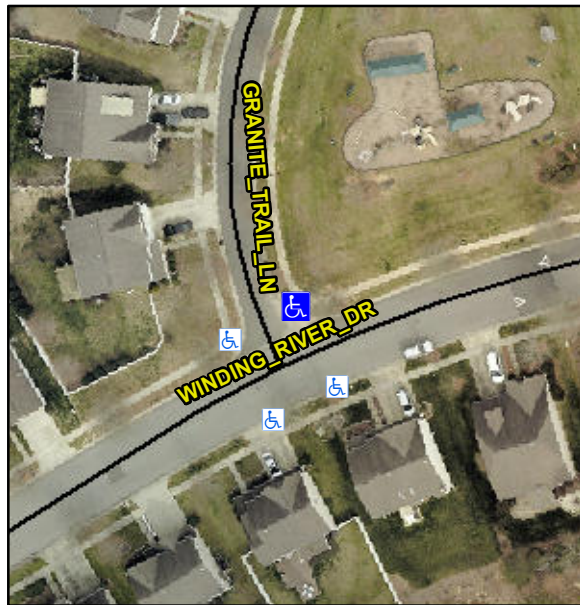

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	75.0	Yes	Ramp Slope (%)	6.2		
	No	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	1.5		
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
Surveyor Notes: N/A	N/A	Shared Landing?	N/A					
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
		X Walk 1 Direction	To W		X Walk 2 Direction	To S		
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
		X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	2.8		
		X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	1.0		
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
		Road Slope (%)	0.4	N/A	Clear Space?	N/A		
PROW/ADA: Not Found, R304.5.1		Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A		
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
		Obstruction Type			Storm Grate/Utility Type			
			N/A			N/A		
Total Cost:		\$	3200.00		Yes	Surface Condition? (G/P)	Good	

Total Cost: \$ 3200.00

