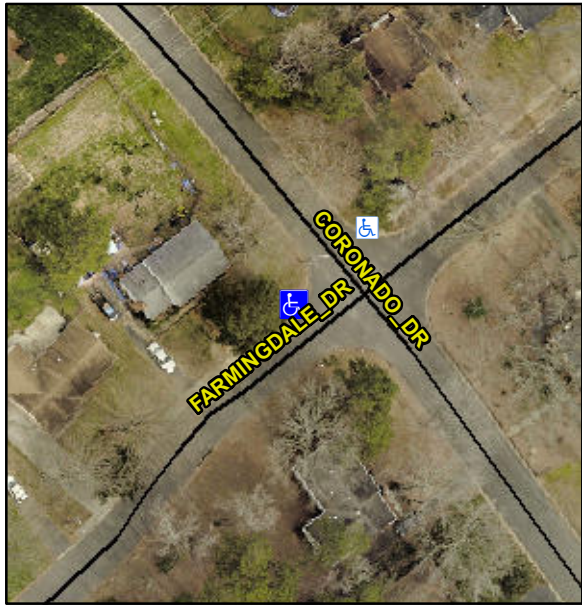


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16168	Main Street: CORONADO_DR	Cross Street: FARMINGDALE_DR	Location: W
ADA ID: 45C801D799CC	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 17.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	54.0	Yes	Ramp Slope (%)	7.4
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.3
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	9.6	N/A	Flare Slope RT (%)	4.5
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
			No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
			No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
			N/A	Shared Landing?	N/A			
PROW/ADA:		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6	
		No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.3	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To SE		X Walk 2 Direction	To NE	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	0.8	
			X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	7.3	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	2.4	N/A	Clear Space?	Yes	
			Road X Slope (%)	6.4	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 3950.00						

