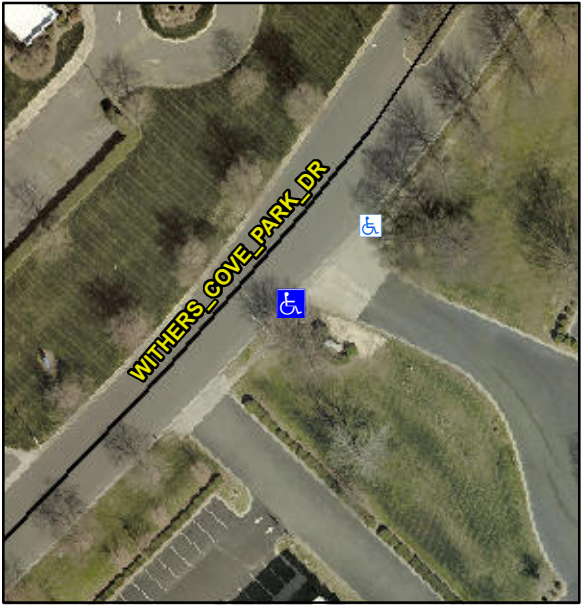


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10042138	Main Street: WITHERS_COVE_PARK_DR	Cross Street: N/A	Location: SW
ADA ID: 4692AB3C93A6	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 46.25			

	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	60.0	No	Ramp Slope (%)	8.8
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2, R304.5.3</p>			No	Ramp Width (in)	40.0	No	Ramp XSlope (%)	7.6
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
<p>Street 1 Name</p> <p>ENTRANCE</p> <p>Stop Condition-Street 2</p> <p>None</p> <p>Street 2 Name</p> <p>WITHERS COVE PARK DR</p> <p>Stop Condition-Street 1</p> <p>None</p>			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	2.7
				X Walk 1 X Slope (%)	2.8		X Walk 2 X Slope (%)	2.6
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	3.8	N/A	Clear Space?	N/A
				Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good

