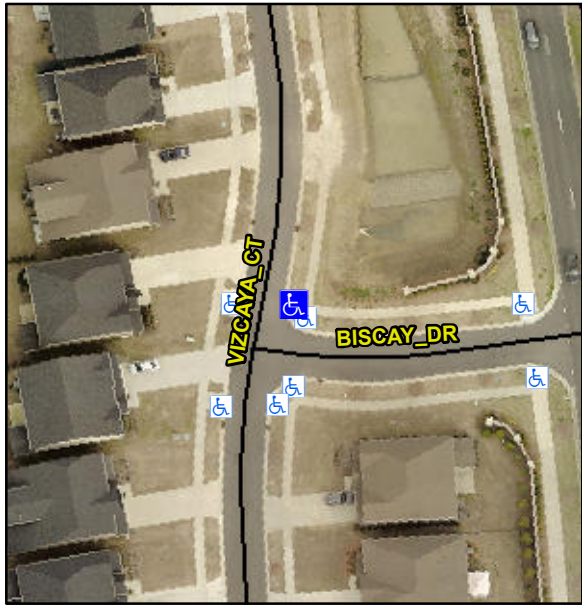


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: VIZCAYA_CT	Cross Street: BISCAY_DR	Location: NE
ADA ID: 4696C232B488	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 20.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	97.5	Yes	Ramp Slope (%)	5.1
	Remove & Replace Gutter.		Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	2.3	Yes	Flare Slope RT (%)	6.7
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	61.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	4.7	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	3.6	Yes	DWS Full Width?	Yes
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7.2, R304.5.4			N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	No	Gutter Slope (%)	8.5
			No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.6
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To W		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good

Street 1 Name	PIZCAYA CT
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost:	\$	2600.00
-------------	----	---------

