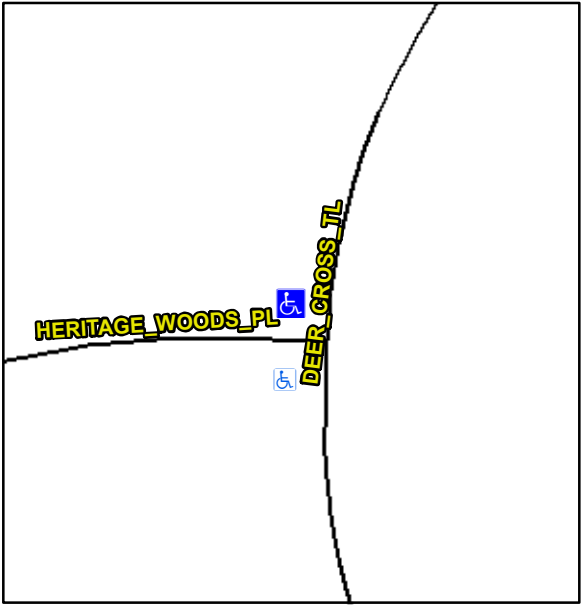


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 3750	Main Street: DEER_CROSS_TL	Cross Street: HERITAGE_WOODS_PL	Location: NW
ADA ID: 47389EC02330	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
 <p>Street 1 Name: HERITAGE WOODS PL</p> <p>Stop Condition-Street 1: StopSign</p> <p>Street 2 Name: N/A</p> <p>Stop Condition-Street 2: N/A</p>	<p>Possible Solutions:</p> <p><b>Remove &amp; Replace Entire Ramp.</b></p> <p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>R304.5.1</b></p>	Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	66.0	N/A	Grade Break?	N/A
		No	Ramp Width (in)	38.0	N/A	Grade Break Slope (%)	0.0
		Yes	Ramp Slope (%)	5.1	N/A	Grade Break XSlope (%)	0.0
		Yes	Ramp XSlope (%)	1.1			
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No		Road Slope (%)	0.5
			X Walk 1 Direction	To S		Road X Slope (%)	5.1
			X Walk 1 Width (in)	N/A		Clear Space?	N/A
			X Walk 1 Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
			X Walk 1 X Slope (%)	5.1	N/A	Storm Grate/Utility Hazard?	N/A
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
		N/A	Any Obstructions?	N/A			N/A
			Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	10.3
Total Cost:		\$	1600.00				

