

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

8.4

0.1 N/A

N/A

N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

No

To N N/A

1.9

0.4

N/A

N/A

N/A

N/A

N/A

Good

Intersection ID: 10021322 Main Street: BLAKENEY\_GREENS\_BV Cross Street: N/A Location: SE

ADA ID: 4799CF0FBC6F Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

Compliance Description


Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Yes

Surface Condition? (G/P)

**Data Compliance Description** 

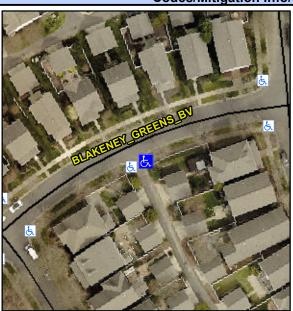

Street 1 Name

Stop Condition-Street 2

Street 2 Name

None

Stop Condition-Street 1

None

POSSIBLE SOLUTION
Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.
Surveyor Notes: N/A
PROW/ADA: R304.2.2

PROW/ADA: R304.2.2		 
Total Cost:	\$ 3200.00	

N/A	Ramp Length (in)	66.0	No	Ramp Slope (%)
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)
N/A	Flare Type LT	N/A	N/A	Flare Type RT
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?
N/A	Landing Length (in)	N/A	N/A	DWS Provided?
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)
N/A	Shared Landing?	N/A		
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?
	X Walk 1 Direction	To SW		X Walk 2 Direction
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?
	Road Slope (%)	0.2	N/A	Clear Space?
	Road X Slope (%)	1.9	N/A	Clear Space to XWalk (in)
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?
	Obstruction Type			Storm Grate/Utility Type
		N/A		





