


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28378	Main Street: BALDWIN_HALL_DR	Cross Street: SOUTHAMPTON_COMMONS_DR	Location: E
ADA ID: 47DB17B6712A	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

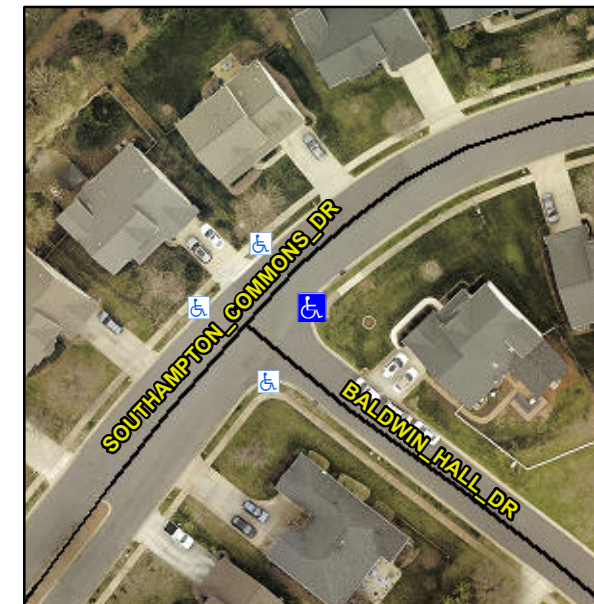

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R305, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.0	Yes	BlendTrans Slope (%)	5.0
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	3.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.2	N/A	Flare Slope RT (%)	9.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	43.0	No	DWS Provided?	No
Yes	Landing Width (in)	81.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	0.2	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.7	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	13.6
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.7		X Walk 2 Slope (%)	5.5
	X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	1.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6		Clear Space?	Yes
	Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	11.6

Street 1 Name **SOUTHAMPTON COMMONS DR**

Stop Condition-Street 1 **None**

Street 2 Name **BALDWIN HILL DR**

Stop Condition-Street 2 **StopSign**

