


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10023486Main Street: CIRCUMFERENTIAL\_RDCross Street: N/ALocation:NWADA ID: 480C9589DDA9Ramp Type: Directional1Initial Pass/Fail: PassOverall Compliance: NoSeverity Score:17.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

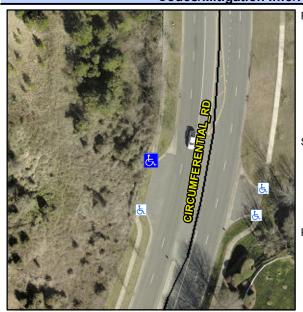

Street 1 Name	N/A
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Possible Solutions:	
Remove & Replace Entire Ramp. Remove & Replace Gutter.	
	,
Surveyor Natae	
Surveyor Notes:	,
N/A	,
	,
PROW/ADA:	
Not Found, R304.5.3, R305.1.4,	
R302.7.2	

Total Cost:	\$ 2350.00

Comp	liance Description	Data	Comp	oliance Description	Data
N/A	Ramp Length (in)	29.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	58.0	Yes	Grade Break Slope (%)	0.2
Yes	Ramp Slope (%)	0.2	Yes	Grade Break XSlope (%)	0.8
Yes	Ramp XSlope (%)	0.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	51.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	58.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	2.0	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
No	Gutter Lip Ht (in)	1.0	No	Gutter X Slope (%)	2.6
N/A	Painted X Walk1?	No		Road Slope (%)	0.4
	X Walk 1 Direction	To S		Road X Slope (%)	2.1
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.1	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
		N/A	No	Curb Slope (%)	9.9





