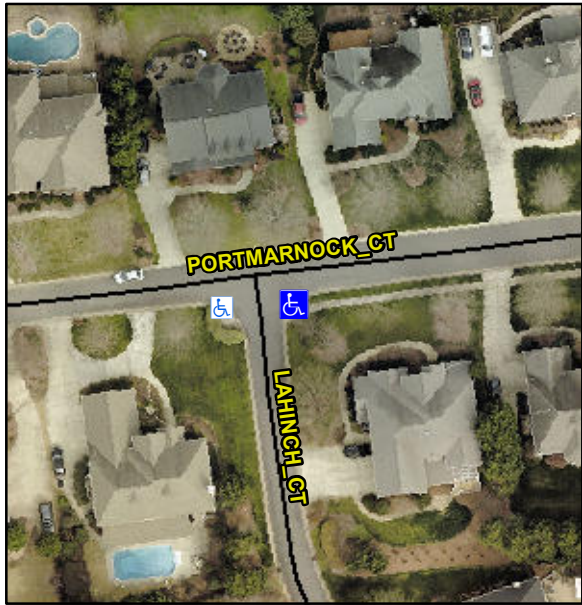


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28132	Main Street: LAHINCH_CT	Cross Street: PORTMARNOCK_CT	Location: SE
ADA ID: 498145286D5A	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 30.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	49.5	Yes	Ramp Slope (%)	5.2
			Yes	Ramp Width (in)	123.0	No	Ramp XSlope (%)	2.9
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	2.3	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	49.0	No	DWS Provided?	No
			Yes	Landing Width (in)	72.0	N/A	DWS Contrast?	No
			No	Landing Slope (%)	4.5	N/A	DWS Length (in)	N/A
			No	Landing X Slope (%)	3.5	N/A	DWS Full Width?	No
		N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	No				
		Yes	Gutter Ponding?	No	No	Gutter Slope (%)		9.9
		No	Gutter Lip Ht (in)	1.5	Yes	Gutter X Slope (%)		1.8
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?		No
			X Walk 1 Direction	To N		X Walk 2 Direction		To W
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)		N/A
			X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)		2.7
			X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)		4.9
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?		N/A
			Road Slope (%)	5.3	N/A	Clear Space?		Yes
			Road X Slope (%)	8.3	N/A	Clear Space to XWalk (in)		N/A
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?		No
			Obstruction Type			Storm Grate/Utility Type		
				N/A				N/A
					Yes	Surface Condition? (G/P)		Good

