


Intersection ID: 14182		Main Street: E_PARK_AV	Cross Street: LYNDHURST_AV	Location:	W																																																																																																																																																						
ADA ID: 49A9D661C02E		Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 26.25																																																																																																																																																						
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance																																																																																																																																																								
<div></div> <div>Possible Solutions: Remove & Replace Entire Ramp.</div> <div>Surveyor Notes: N/A</div> <div>PROW/ADA: R304.2.2, R304.5.3</div> <div><div>Street 1 Name Stop Condition-Street 1 Street 2 Name Stop Condition-Street 2</div><div>LYNDHURST AV StopSign N/A N/A</div></div> <div>Total Cost: \$ 1600.00</div>			<table><thead><tr><th>Compliance</th><th>Description</th><th>Data</th><th>Compliance</th><th>Description</th><th>Data</th></tr></thead><tbody><tr><td>N/A</td><td>Ramp Length (in)</td><td>77.0</td><td>N/A</td><td>Grade Break?</td><td>N/A</td></tr><tr><td>Yes</td><td>Ramp Width (in)</td><td>48.0</td><td>N/A</td><td>Grade Break Slope (%)</td><td>0.0</td></tr><tr><td>No</td><td>Ramp Slope (%)</td><td>12.0</td><td>N/A</td><td>Grade Break XSlope (%)</td><td>0.0</td></tr><tr><td>No</td><td>Ramp XSlope (%)</td><td>2.2</td><td></td><td></td><td></td></tr><tr><td>N/A</td><td>Flare Type LT</td><td>N/A</td><td>N/A</td><td>Flare Type RT</td><td>N/A</td></tr><tr><td>N/A</td><td>Flare Slope LT (%)</td><td>N/A</td><td>N/A</td><td>Flare Slope RT (%)</td><td>0.0</td></tr><tr><td>N/A</td><td>Flare Traversable LT?</td><td>N/A</td><td>N/A</td><td>Flare Traversable RT?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Length (in)</td><td>0.0</td><td>N/A</td><td>DWS Provided?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Width (in)</td><td>0.0</td><td>N/A</td><td>DWS Contrast?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Slope (%)</td><td>0.0</td><td>N/A</td><td>DWS Length (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing X Slope (%)</td><td>0.0</td><td>N/A</td><td>DWS Full Width?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Curb? (Y/N)</td><td>N/A</td><td>N/A</td><td>DWS Offset LT (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Shared Landing?</td><td>N/A</td><td>N/A</td><td>DWS Offset RT (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter Ponding?</td><td>0.0</td><td>N/A</td><td>Gutter Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter Lip Ht (in)</td><td>0.0</td><td>N/A</td><td>Gutter X Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Painted X Walk1?</td><td>No</td><td></td><td>Road Slope (%)</td><td>3.7</td></tr><tr><td></td><td>X Walk 1 Direction</td><td>To SE</td><td></td><td>Road X Slope (%)</td><td>5.9</td></tr><tr><td></td><td>X Walk 1 Width (in)</td><td>N/A</td><td></td><td>Clear Space?</td><td>N/A</td></tr><tr><td></td><td>X Walk 1 Slope (%)</td><td>3.7</td><td>N/A</td><td>Clear Space to XWalk (in)</td><td>N/A</td></tr><tr><td></td><td>X Walk 1 X Slope (%)</td><td>5.9</td><td>N/A</td><td>Storm Grate/Utility Hazard?</td><td>N/A</td></tr><tr><td>N/A</td><td>Ramp inside XWalk1?</td><td>N/A</td><td></td><td>Storm Grate/Utility Type</td><td></td></tr><tr><td>N/A</td><td>Any Obstructions?</td><td>N/A</td><td></td><td></td><td>N/A</td></tr><tr><td></td><td>Obstruction Type</td><td></td><td>Yes</td><td>Surface Condition? (G/P)</td><td>Good</td></tr><tr><td></td><td></td><td></td><td>N/A</td><td>Curb Slope (%)</td><td>5.8</td></tr></tbody></table>			Compliance	Description	Data	Compliance	Description	Data	N/A	Ramp Length (in)	77.0	N/A	Grade Break?	N/A	Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0	No	Ramp Slope (%)	12.0	N/A	Grade Break XSlope (%)	0.0	No	Ramp XSlope (%)	2.2				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A	N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A	N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A	N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A	N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A	N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A	N/A	Painted X Walk1?	No		Road Slope (%)	3.7		X Walk 1 Direction	To SE		Road X Slope (%)	5.9		X Walk 1 Width (in)	N/A		Clear Space?	N/A		X Walk 1 Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A		X Walk 1 X Slope (%)	5.9	N/A	Storm Grate/Utility Hazard?	N/A	N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type		N/A	Any Obstructions?	N/A			N/A		Obstruction Type		Yes	Surface Condition? (G/P)	Good				N/A	Curb Slope (%)	5.8
Compliance	Description	Data	Compliance	Description	Data																																																																																																																																																						
N/A	Ramp Length (in)	77.0	N/A	Grade Break?	N/A																																																																																																																																																						
Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0																																																																																																																																																						
No	Ramp Slope (%)	12.0	N/A	Grade Break XSlope (%)	0.0																																																																																																																																																						
No	Ramp XSlope (%)	2.2																																																																																																																																																									
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A																																																																																																																																																						
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0																																																																																																																																																						
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A																																																																																																																																																						
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A																																																																																																																																																						
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A																																																																																																																																																						
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A																																																																																																																																																						
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A																																																																																																																																																						
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A																																																																																																																																																						
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A																																																																																																																																																						
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A																																																																																																																																																						
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A																																																																																																																																																						
N/A	Painted X Walk1?	No		Road Slope (%)	3.7																																																																																																																																																						
	X Walk 1 Direction	To SE		Road X Slope (%)	5.9																																																																																																																																																						
	X Walk 1 Width (in)	N/A		Clear Space?	N/A																																																																																																																																																						
	X Walk 1 Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A																																																																																																																																																						
	X Walk 1 X Slope (%)	5.9	N/A	Storm Grate/Utility Hazard?	N/A																																																																																																																																																						
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type																																																																																																																																																							
N/A	Any Obstructions?	N/A			N/A																																																																																																																																																						
	Obstruction Type		Yes	Surface Condition? (G/P)	Good																																																																																																																																																						
			N/A	Curb Slope (%)	5.8																																																																																																																																																						

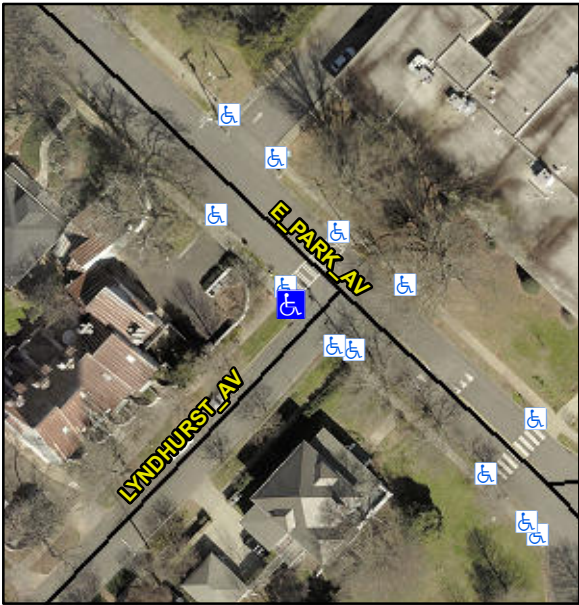