


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10878	Main Street: SPRATT_ST	Cross Street: N/A	Location: NE
ADA ID: 4A514F44FA7E	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 20.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

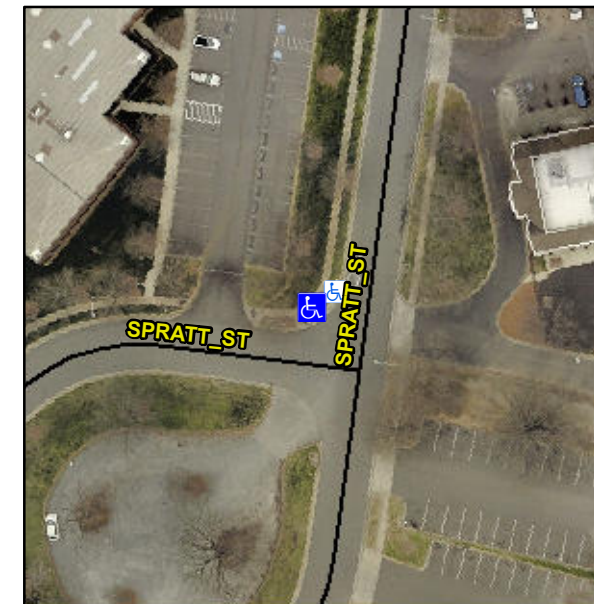

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R304.5.3, R304.2.3, R305.1.4, R305.2, R302.7, R302.7.2**

Total Cost: \$ 1850.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	67.0	Yes	Ramp Slope (%)	5.2
Yes	Ramp Width (in)	50.0	Yes	Ramp XSlope (%)	3.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	9.4	No	Flare Slope RT (%)	10.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	30.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	52.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	5.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	3.7
No	Gutter Lip Ht (in)	1.5	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	5.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

