


Intersection ID: N/A	Main Street: SUMMERFIELD RIDGE LN	Cross Street: CALABASSAS LN	Location:	SW
ADA ID: 4A5263120F64	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance								
	Possible Solutions:		Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			Compliance	Description	Data	Compliance	Description	Data
	Surveyor Notes:		N/A			N/A	Ramp Length (in)	44.0	Yes	Ramp Slope (%)	6.8
	PROW/ADA:		Not Found, R304.5.1, R304.5.3			No	Ramp Width (in)	42.5	No	Ramp XSlope (%)	5.5
						N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
						N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
						N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
						N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
						N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
						N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
						N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
					N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
					N/A	Shared Landing?	N/A				
					N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	N/A
					N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	N/A
					N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	No
						X Walk 1 Direction	To E		X Walk 2 Direction	To N	To N
					N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	N/A
						X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	6.1	6.1
						X Walk 1 X Slope (%)	7.2		X Walk 2 X Slope (%)	0.3	0.3
					N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	N/A
						Road Slope (%)	5.9	N/A	Clear Space?	N/A	N/A
						Road X Slope (%)	1.5	N/A	Clear Space to XWalk (in)	N/A	N/A
					N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	N/A
						Obstruction Type			Storm Grate/Utility Type		
							N/A			N/A	N/A
								Yes	Surface Condition? (G/P)	Good	Good
Total Cost:			\$	3200.00							

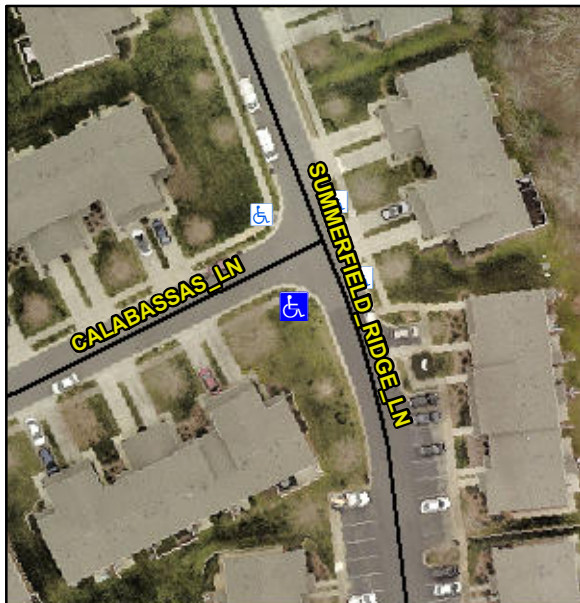