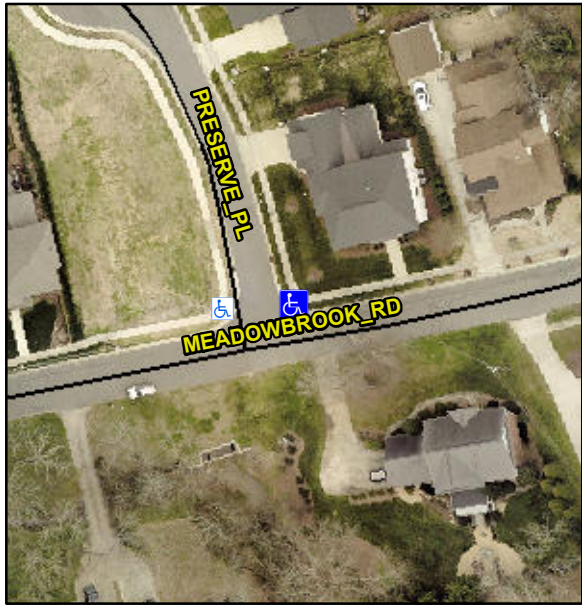


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 49284	Main Street: PRESERVE_PL	Cross Street: MEADOWBROOK_RD	Location: NE
ADA ID: 4A7A1AA9DF38	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	9.8
			No	Ramp Width (in)	47.5	Yes	Ramp XSlope (%)	0.4
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R304.5.1, R304.2.2	N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To W		X Walk 2 Direction	To S
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	0.2
				X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	2.4
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	0.1	N/A	Clear Space?	N/A
				Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Street 1 Name		PRESERVE PL						
Stop Condition-Street 2		StopSign						
Street 2 Name		MEADOBROOK RD						
Stop Condition-Street 1		None						
Total Cost:		\$ 3200.00						

