

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11985	Main Street: MCGILL_GARDEN_WY	Cross Street: N_DAVIDSON_ST	Location: E
ADA ID: 4AFD86EB00A9	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 22.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

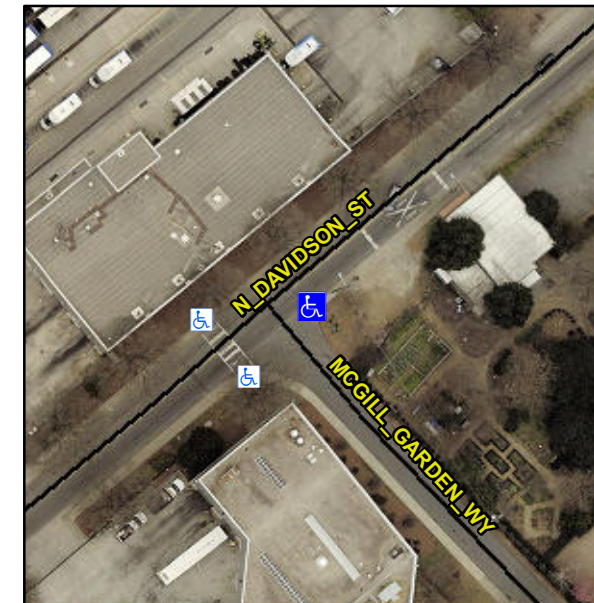

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.1, R304.5.3, R305.1.4, R305.2,
R302.7, R302.7.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	54.0	Yes	Grade Break Slope (%)	0.9
Yes	Ramp Slope (%)	2.3	Yes	Grade Break XSlope (%)	0.7
Yes	Ramp XSlope (%)	0.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	62.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	45.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	10.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	9.0
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	6.2
No	Gutter Lip Ht (in)	1.5	No	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	No		Road Slope (%)	2.6
	X Walk 1 Direction	To SW		Road X Slope (%)	0.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	1.3

Total Cost: \$ 2350.00

