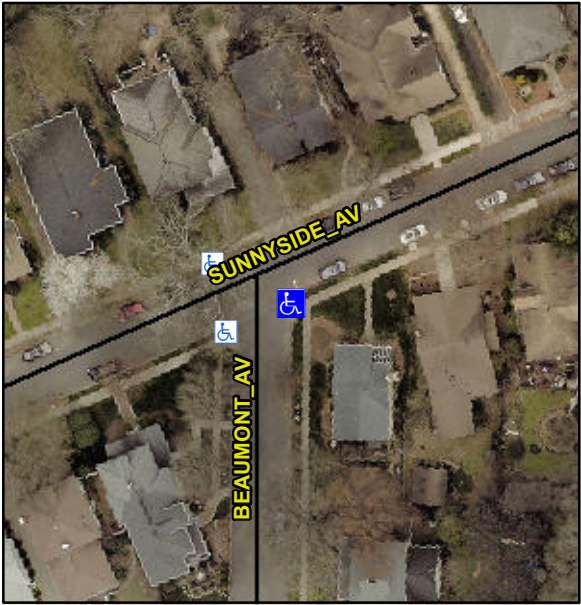


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13097	Main Street: BEAUMONT_AV	Cross Street: SUNNYSIDE_AV	Location: SE
ADA ID: 4B00DEB76308	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	66.0
			Yes	Ramp Width (in)	61.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2, R304.5.3</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	Yes
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To N
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	5.4
				X Walk 1 X Slope (%)	1.6
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	3.9
				Road X Slope (%)	1.8
			N/A	Any Obstructions?	N/A
				Obstruction Type	
Total Cost:			\$	3200.00	

Street 1 Name	SUNNYSIDE AV
Stop Condition-Street 2	None
Street 2 Name	BEAUMONT AV
Stop Condition-Street 1	StopSign

