


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10021653		Main Street: BRANDON_FOREST_DR		Cross Street: N/A		Location: N					
ADA ID: 4BDE1C5A0366		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 13.75			
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance							
				Possible Solutions:		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		106.0	
Surveyor Notes:				N/A		Yes		Ramp Width (in)		96.0	
						No		Ramp Slope (%)		8.9	
PROW/ADA:				R304.2.2, R304.5.3		No		Ramp XSlope (%)		3.0	
						N/A		Flare Type LT		N/A	
Street 1 Name				ENTRANCE		N/A		Flare Slope LT (%)		N/A	
				StopSign		N/A		Flare Traversable LT?		N/A	
Street 2 Name				N/A		N/A		Landing Length (in)		0.0	
				N/A		N/A		Landing Width (in)		0.0	
Stop Condition-Street 1						N/A		Landing Slope (%)		0.0	
						N/A		Landing X Slope (%)		0.0	
Stop Condition-Street 2						N/A		Landing Curb? (Y/N)		N/A	
						N/A		Shared Landing?		N/A	
Total Cost:				\$ 1600.00		N/A		Gutter Ponding?		0.0	
						N/A		Gutter Lip Ht (in)		0.0	
						N/A		Painted X Walk1?		No	
								X Walk 1 Direction		To SE	
						N/A		X Walk 1 Width (in)		N/A	
						N/A		X Walk 1 Slope (%)		0.6	
						N/A		X Walk 1 X Slope (%)		2.4	
						N/A		Ramp inside XWalk1?		N/A	
						N/A		Any Obstructions?		N/A	
								Obstruction Type		Yes	
						N/A		Surface Condition? (G/P)		Good	
						N/A		Curb Slope (%)		4.0	

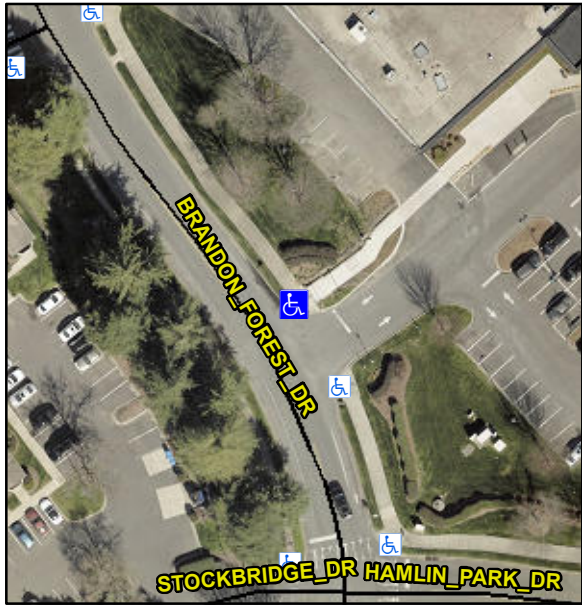