

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 19817	Main Street: MONROE_RD	Cross Street: TIMBER_SPRINGS_DR	Location: SE
ADA ID: 4C06D06926CD	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

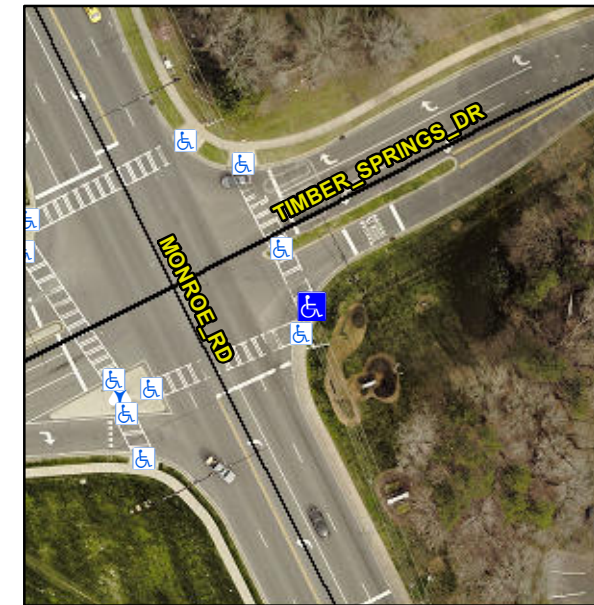

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Sidewalk.**

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.5.1, R304.5.3, R304.3.2

Total Cost:

\$ 2200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	67.0	N/A	Ramp Length RT (in)	64.0
No	Ramp Width LT (in)	36.0	No	Ramp Width RT (in)	36.0
Yes	Ramp Slope LT (%)	3.5	No	Ramp Slope RT (%)	10.2
No	Ramp XSlope LT (%)	4.4	No	Ramp XSlope RT (%)	5.9
N/A	Ramp Length (in)	24.5	Yes	Ramp Slope (%)	5.4
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	113.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	0.0

