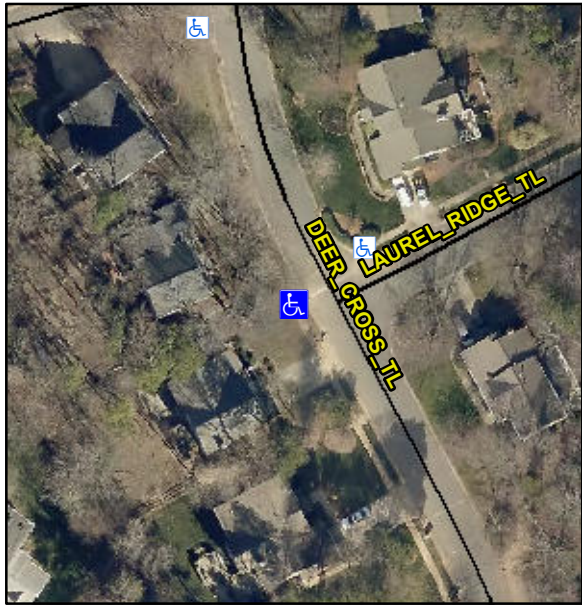


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3794	Main Street: DEER_CROSS_TL	Cross Street: LAUREL_RIDGE_TL	Location: W
ADA ID: 4C2ADB805B8F	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 32.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	49.0	Yes	Ramp Slope (%)	5.9
	Remove & Replace Gutter.		Yes	Ramp Width (in)	49.0	No	Ramp XSlope (%)	4.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	10.5	Yes	Flare Slope RT (%)	3.0
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	47.0	No	DWS Provided?	No
			Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
			Yes	Landing Slope (%)	0.9	N/A	DWS Length (in)	N/A
			No	Landing X Slope (%)	4.0	N/A	DWS Full Width?	No
Surveyor Notes:	N/A		N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	No			
	PROW/ADA:		Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.1
	Not Found, R304.5.3, R304.2.1,		No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	3.1
	R304.2.3, R305, R302.7.2, R304.5.4		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To E		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	3.5		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	Clear Space?	Yes
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	2600.00					

