

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48581	Main Street: WATERLILY_LN	Cross Street: RUMPLE_RD	Location: SE
ADA ID: 4C4AC3378533	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

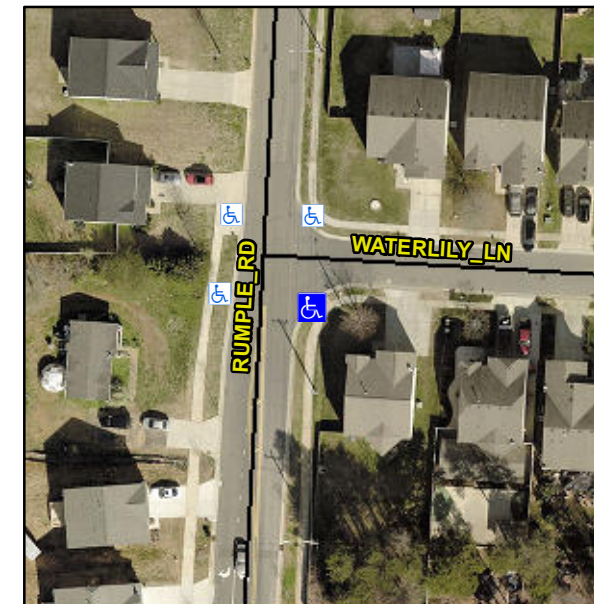

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	N/A	N/A	Ramp Length RT (in)	67.0
N/A	Ramp Width LT (in)	N/A	Yes	Ramp Width RT (in)	53.0
N/A	Ramp Slope LT (%)	N/A	Yes	Ramp Slope RT (%)	7.5
N/A	Ramp XSlope LT (%)	N/A	Yes	Ramp XSlope RT (%)	0.3
Yes	Landing Length (in)	101.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	89.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	3.9
	X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	1.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.9	N/A	Clear Space?	Yes
	Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	11.4

Street 1 Name WATERLILY LN
 Stop Condition-Street 1 StopSign
 Street 2 Name RUMPLE RD
 Stop Condition-Street 2 None

