

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: YORK_CENTER	Cross Street: N/A	Location: SE
ADA ID: 4C9C5C2C30BB	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

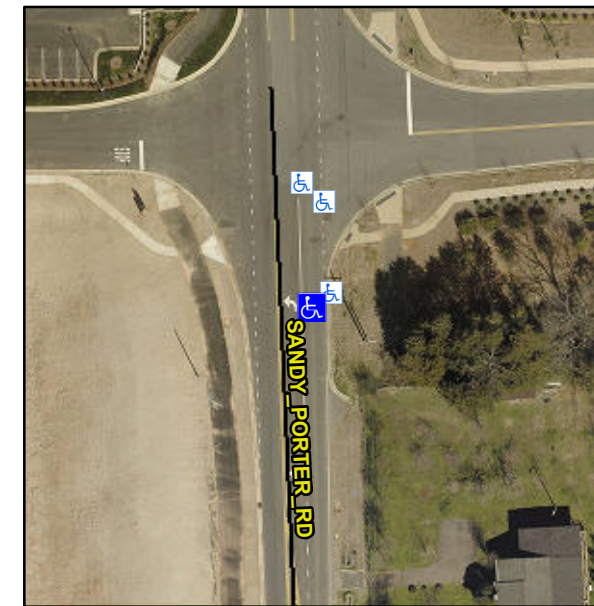

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.2**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	BlendTrans Slope (%)	2.4
Yes	Ramp Width (in)	60.0	No	BlendTrans XSlope (%)	3.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	2.8	N/A	Flare Slope RT (%)	7.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	62.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	5.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.6		X Walk 2 Slope (%)	4.2
	X Walk 1 X Slope (%)	5.0		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.7		Clear Space?	Yes
	Road X Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	7.3

Street 1 Name SHUTTERFLY RD  
 Stop Condition-Street 1 StopSign  
 Street 2 Name SANDY PORTER RD  
 Stop Condition-Street 2 None

