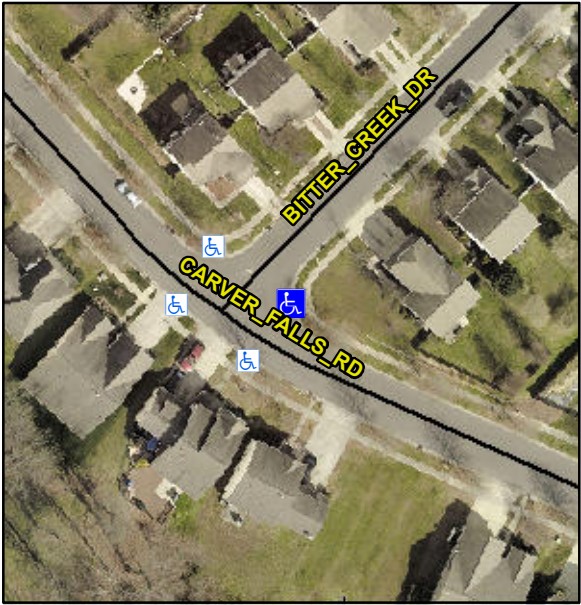


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 45775	Main Street: BITTER_CREEK_DR	Cross Street: CARVER_FALLS_RD	Location: E
ADA ID: 4D19D8DEB027	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Compliance	Description	Data
<p>Surveyor Notes:</p> <p>N/A</p>			N/A	Ramp Length (in)	60.0
			Yes	Ramp Width (in)	60.0
<p>PROW/ADA:</p> <p>R304.5.3</p>			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To NW
			N/A	X Walk 2 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	5.4
				X Walk 2 Slope (%)	1.6
				X Walk 1 X Slope (%)	2.1
				X Walk 2 X Slope (%)	6.5
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	5.3
			N/A	Clear Space?	N/A
				Road X Slope (%)	4.6
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type	
			N/A	Storm Grate/Utility Type	
					N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	BITTER CREEK DR
Stop Condition-Street 2	StopSign
Street 2 Name	CARVER FALLS RD
Stop Condition-Street 1	None

Total Cost: \$ 3200.00

