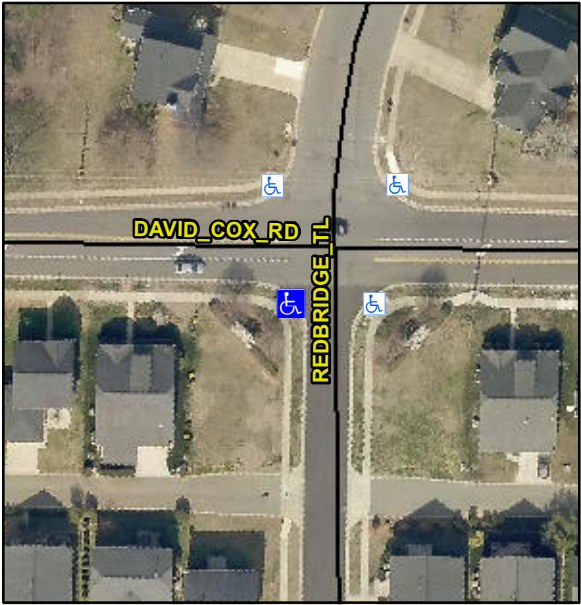


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 4080	Main Street: DAVID_COX_RD	Cross Street: REDBRIDGE_TL	Location: SW
ADA ID: 4D20FE69F999	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Yes	Ramp Length (in)	64.0
			N/A	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
			To E	X Walk 1 Direction	To N
			N/A	X Walk 1 Width (in)	N/A
			1.3	X Walk 1 Slope (%)	6.5
			7.0	X Walk 1 X Slope (%)	2.7
			N/A	Ramp inside XWalk1?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>			N/A	Ramp inside XWalk2?	N/A
			7.0	Road Slope (%)	N/A
			3.5	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
Street 1 Name	REDBRIDGE TL				
Stop Condition-Street 2	StopSign				
Street 2 Name	DAVID COX RD				
Stop Condition-Street 1	None				
Total Cost:	\$ 3200.00				

