

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47993	Main Street: HITCHCOCK_LN	Cross Street: MCCULLOUGH_DR	Location: SE
ADA ID: 4D5455B52EE4	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.75	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

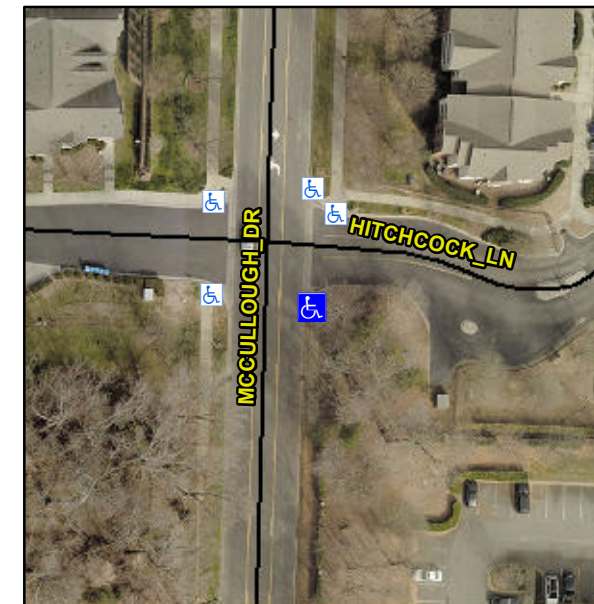

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.1.4, R305.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	64.0	Yes	BlendTrans Slope (%)	4.9
Yes	Ramp Width (in)	64.0	No	BlendTrans XSlope (%)	4.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	15.3	N/A	Flare Slope RT (%)	3.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.2
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	2.9
	X Walk 1 X Slope (%)	11.1		X Walk 2 X Slope (%)	2.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6		Clear Space?	Yes
	Road X Slope (%)	0.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name **HITCHCOCK LN**
 Stop Condition-Street 1 **StopSign**
 Street 2 Name **MCCULLOUGH DR**
 Stop Condition-Street 2 **None**

