


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 13292	Main Street: E_3RD_ST	Cross Street: S_MCDOWELL_ST	Location: S
ADA ID: 4D7287974944	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

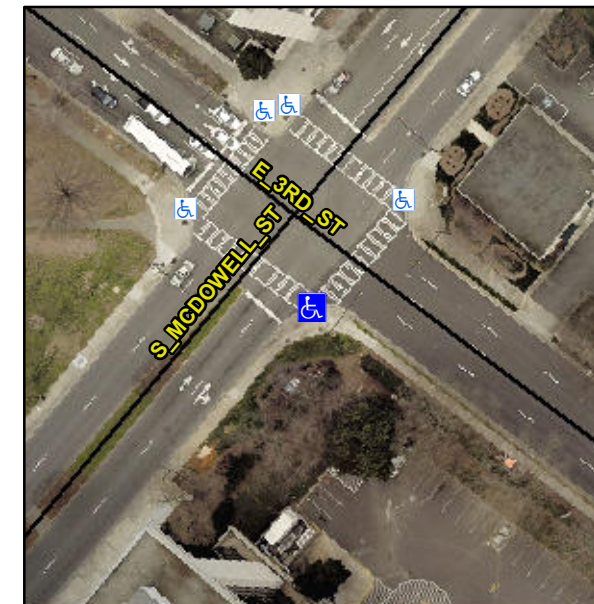

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R305.2**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	80.0	Yes	Ramp Slope (%)	5.7
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.7	Yes	Flare Slope RT (%)	1.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	73.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.8	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	118.0	N/A	X Walk 2 Width (in)	118.0
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	1.8
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	2.7
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.9	N/A	Clear Space?	Yes
	Road X Slope (%)	2.2	Yes	Clear Space to XWalk (in)	48.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

