


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10006563 Main Street: SHADE_VALLEY_RD Cross Street: OAKHURST_COMMONS_DR Location: SW ADA ID: 4D949ABB9244 Ramp Type: Directional1 Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 13.75

Codes/Mitigation Info/P

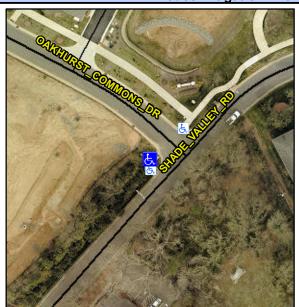



Possible Solution		
Possible Solutions:	Compliand	
Remove & Replace Entire Ramp.	N/A	R
•	Yes	R
	No	Ra
	No	Ra
	N/A	FI
	N/A	FI
Surveyor Notes:	N/A	FI
N/A	N/A	La
	N/A	La
	N/A	La
	N/A	La
PROW/ADA:	N/A	La
R304.2.2, R304.5.3	N/A	Sł
·	N/A	G
	N/A	G
	N/A	Pa
		Χ
		Χ
		Χ
		Χ
	N/A	Ra

Total Cost:	\$ 1600.00

Field Measurements/Component Compliance								
Compl	iance Description	Data	Comp	liance Description	Data			
N/A	Ramp Length (in)	78.0	N/A	Grade Break?	N/A			
Yes	Ramp Width (in)	64.0	N/A	Grade Break Slope (%)	0.0			
No	Ramp Slope (%)	8.7	N/A Grade Break XSlope (%)		0.0			
No	Ramp XSlope (%)	2.7						
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A			
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0			
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A			
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A			
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A			
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A			
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A			
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A			
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A			
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A			
N/A	Gutter Lip Ht (in)	2.0	N/A	Gutter X Slope (%)	N/A			
N/A	Painted X Walk1?	No		Road Slope (%)	2.5			
	X Walk 1 Direction	To NE		Road X Slope (%)	2.2			
	X Walk 1 Width (in)	N/A		Clear Space?	N/A			
	X Walk 1 Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A			
	X Walk 1 X Slope (%)	2.2	N/A	Storm Grate/Utility Hazard?	N/A			
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type				
N/A	Any Obstructions?	N/A			N/A			
	Obstruction Type		Yes	Surface Condition? (G/P)	Good			
		N/A	N/A	Curb Slope (%)	4.9			





