

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

5.9

3.9

N/A

Good

Intersection ID: 4167Main Street: CLAUDE\_FREEMAN\_DRCross Street: W\_MALLARD\_CREEK\_CHURCH\_RDLocation:EADA ID: 4DEA67A7597FRamp Type: PerpInitial Pass/Fail: FailOverall Compliance: NoSeverity Score:10

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Yes

No

N/A

Yes

Compliance Description

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

**DWS Provided?** 

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Flare Type RT

Data

77.0

42.0

N/A

Yes

To NW

112.0

1.5

3.3


Yes

N/A

N/A

N/A

N/A

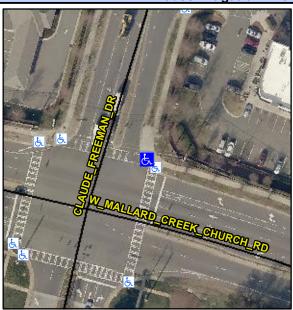

Street 1 Name
CLAUDE FREEMAN DR
Stop Condition-Street 2
Signal
Street 2 Name
N/A
Stop Condition-Street 1
N/A

Possible Solution		Field Meas
Possible Solutions:	Compl	iance Description
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)
·	No	Ramp Width (in)
	N/A	Flare Type LT
	N/A	Flare Slope LT (%)
	N/A	Flare Traversable LT?
	N/A	Landing Length (in)
Surveyor Notes:	N/A	Landing Width (in)
N/A	N/A	Landing Slope (%)
	N/A	Landing X Slope (%)
	N/A	Landing Curb? (Y/N)
	N/A	Shared Landing?
PROW/ADA:	N/A	Gutter Ponding?
R304.5.1, R304.5.3	N/A	Gutter Lip Ht (in)
	N/A	Painted X Walk1?
		X Walk 1 Direction
	N/A	X Walk 1 Width (in)
		X Walk 1 Slope (%)
		X Walk 1 X Slope (%)
	N/A	Ramp inside XWalk1?
		Road Slope (%)

Total Cost:



N/A

1850.00

Road X Slope (%)

Any Obstructions?

**Obstruction Type** 

