

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                         |                                  |                        |
|------------------------|-------------------------|----------------------------------|------------------------|
| Intersection ID: 12056 | Main Street: ELLIOTT_ST | Cross Street: N_I-77_EXIT_10A_RA | Location: NE           |
| ADA ID: 4DEFACDB710D   | Ramp Type: Combination2 | Initial Pass/Fail: Pass          | Overall Compliance: No |
|                        |                         | Severity Score: 10               |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

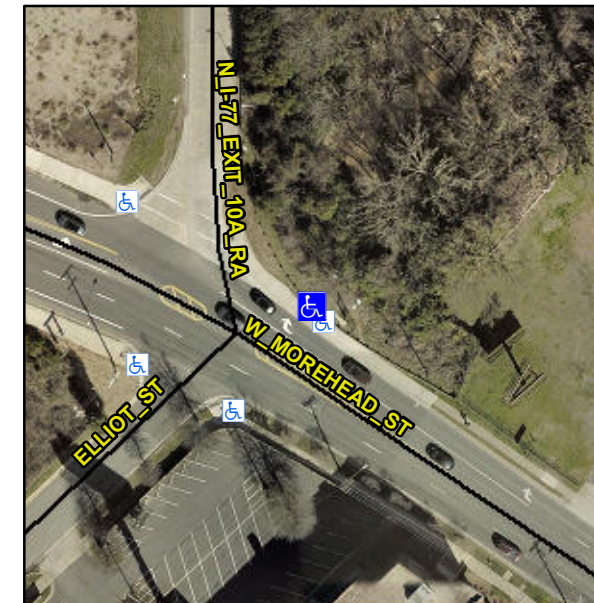

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2**

Total Cost: \$ 1600.00

| Compliance | Description           | Data                 | Compliance | Description                 | Data   |
|------------|-----------------------|----------------------|------------|-----------------------------|--------|
| N/A        | Ramp Length LT (in)   | N/A                  | N/A        | Ramp Length RT (in)         | 74.0   |
| N/A        | Ramp Width LT (in)    | N/A                  | Yes        | Ramp Width RT (in)          | 95.0   |
| N/A        | Ramp Slope LT (%)     | N/A                  | Yes        | Ramp Slope RT (%)           | 3.3    |
| N/A        | Ramp XSlope LT (%)    | N/A                  | Yes        | Ramp XSlope RT (%)          | 1.9    |
| N/A        | Ramp Length (in)      | 95.0                 | Yes        | Ramp Slope (%)              | 1.7    |
| Yes        | Ramp Width (in)       | 92.0                 | Yes        | Ramp XSlope (%)             | 1.4    |
| Yes        | Flare Type L          | Curbed_NoWalkSurface | N/A        | Flare Type RT               | Sloped |
| N/A        | Flare Slope LT (%)    | N/A                  | Yes        | Flare Slope RT (%)          | 2.6    |
| N/A        | Flare Traversable LT? | No                   | N/A        | Flare Traversable RT?       | Yes    |
| No         | Landing Length (in)   | N/A                  | Yes        | DWS Provided?               | Yes    |
| No         | Landing Width (in)    | N/A                  | Yes        | DWS Contrast?               | Yes    |
| No         | Landing Slope (%)     | N/A                  | Yes        | DWS Length (in)             | 24.0   |
| No         | Landing X Slope (%)   | N/A                  | Yes        | DWS Full Width?             | Yes    |
| N/A        | Landing Curb? (Y/N)   | Yes                  | No         | DWS Offset (in)             | 4.0    |
| N/A        | Shared Landing?       | No                   |            |                             |        |
| Yes        | Gutter Ponding?       | No                   | Yes        | Gutter Slope (%)            | 0.7    |
| Yes        | Gutter Lip Ht (in)    | 0.0                  | Yes        | Gutter X Slope (%)          | 1.5    |
| N/A        | Painted X Walk1?      | Yes                  | N/A        | Painted X Walk2?            | N/A    |
|            | X Walk 1 Direction    | To W                 |            | X Walk 2 Direction          | N/A    |
|            | X Walk 1 Width (in)   | 108.0                |            | X Walk 2 Width (in)         | N/A    |
|            | X Walk 1 Slope (%)    | 1.9                  |            | X Walk 2 Slope (%)          | N/A    |
|            | X Walk 1 X Slope (%)  | 4.0                  |            | X Walk 2 X Slope (%)        | N/A    |
| Yes        | Ramp inside XWalk1?   | Yes                  | N/A        | Ramp inside XWalk2?         | N/A    |
|            | Road Slope (%)        | N/A                  |            | Clear Space?                | Yes    |
|            | Road X Slope (%)      | N/A                  | N/A        | Clear Space to XWalk (in)   | N/A    |
|            |                       |                      | Yes        | Any Obstruction?            | No     |
|            |                       |                      |            | Obstruction Type            | N/A    |
|            |                       |                      | Yes        | Storm Grate/Utility Hazard? | No     |
|            |                       |                      |            | Storm Grate/Utility Type    | N/A    |
|            |                       |                      | Yes        | Surface Condition? (G/P)    | Good   |
|            |                       |                      |            | Curb Slope (%)              | 0.4    |

