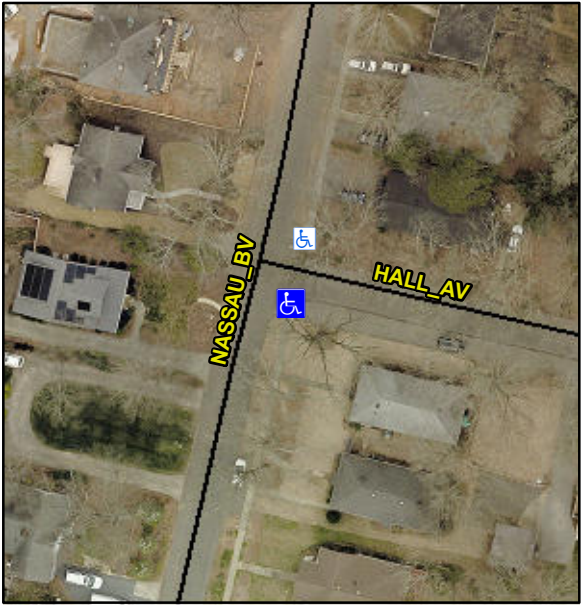


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12902	Main Street: HALL_AV	Cross Street: NASSAU_BV	Location: SE
ADA ID: 4E06324C275A	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
 <p>Street 1 Name: HALL AV</p> <p>Stop Condition-Street 1: StopSign</p> <p>Street 2 Name: N/A</p> <p>Stop Condition-Street 2: N/A</p>	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	98.0	N/A
			Yes	Ramp Width (in)	49.0	N/A
			No	Ramp Slope (%)	14.9	N/A
			No	Ramp XSlope (%)	3.7	N/A
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	0.0	N/A
			N/A	Landing Width (in)	0.0	N/A
			N/A	Landing Slope (%)	0.0	N/A
			N/A	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	0.0	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To N	N/A
				X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	13.3	N/A
				X Walk 1 X Slope (%)	1.2	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		N/A
					Yes	N/A
					N/A	N/A
					Good	6.6

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2, R304.5.3

Total Cost:

\$ 1600.00

