


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 54461	Main Street: FENWAY_DR	Cross Street: FLINT_HILL_DR	Location: SE
ADA ID: 4E51C5DFF285	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 20
			Field Measurements/Component Compliance

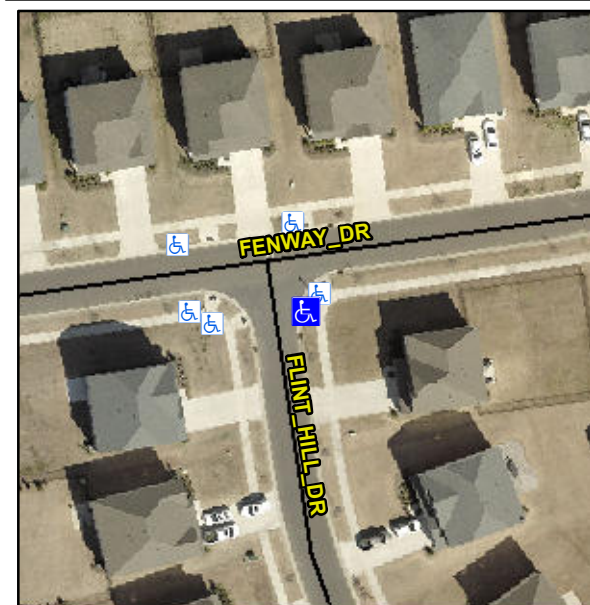

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.2, R302.7.2, R304.5.4

Street 1 Name **FLINT HILL DR**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

Total Cost: \$ **1550.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	5.2
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.5	Yes	Flare Slope RT (%)	0.2
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.6
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

