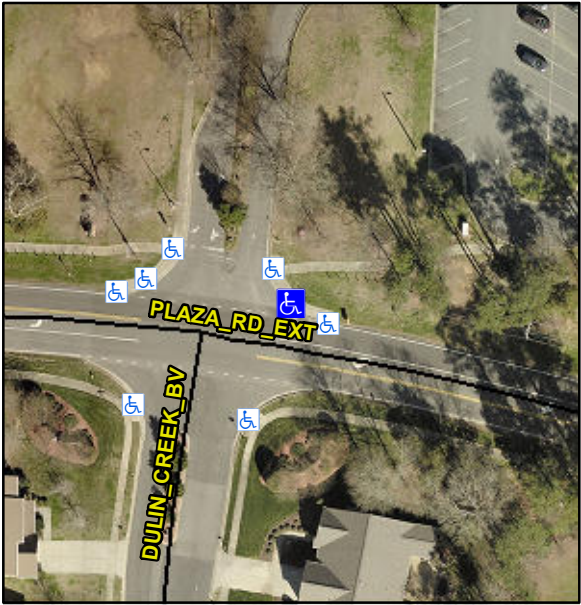



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 45130	Main Street: DULIN_CREEK_BV	Cross Street: PLAZA_RD_EXT	Location: NE
ADA ID: 4E54ACC5B613	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 31.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	59.0
			No	Ramp Width LT (in)	35.5
			No	Ramp Slope LT (%)	9.2
			No	Ramp XSlope LT (%)	3.0
			N/A	Ramp Length (in)	24.0
			Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3, R304.3.2</p>			N/A	Ramp Slope RT (%)	7.3
			No	Ramp XSlope RT (%)	2.1
			Yes	Ramp Slope (%)	4.3
			No	Ramp XSlope (%)	2.5
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To S
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	3.3
				X Walk 1 X Slope (%)	0.8
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
				Road X Slope (%)	N/A
			N/A	Ramp inside XWalk2?	N/A
				Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
					N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	21.6

Total Cost: \$ 1800.00