


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10031812	Main Street: MILLENNIUM_AV	Cross Street: AUDUBON_PARK_DR	Location:	N
ADA ID: 4E8628AE21A0	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

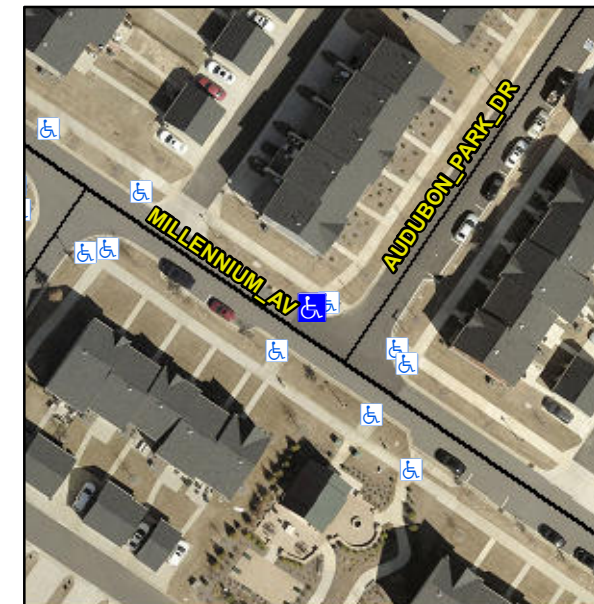

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.2, R304.5.3

Total Cost: \$ 1550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	51.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	70.0	Yes	Grade Break Slope (%)	0.5
Yes	Ramp Slope (%)	5.0	Yes	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	1.7			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	33.0
N/A	Shared Landing?	Yes	No	DWS Offset RT (in)	14.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.7
N/A	Painted X Walk1?	No		Road Slope (%)	2.5
	X Walk 1 Direction	To SW		Road X Slope (%)	2.1
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.1	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.8

