


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9693	Main Street: MULBERRY_AV	Cross Street: PATTON_AV	Location: SE
ADA ID: 4ECF66B64391	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 7.5			

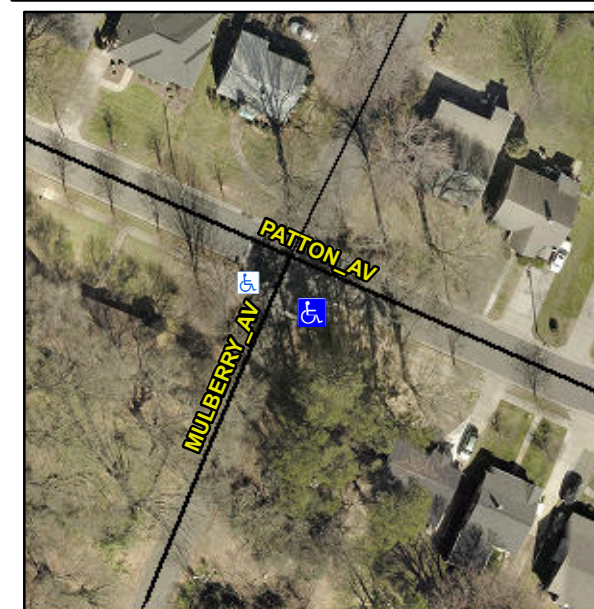

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R304.5.2, R305.1.4,
R305.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	106.5	No	Grade Break?	No
Yes	Ramp Width (in)	56.0	N/A	Grade Break Slope (%)	6.8
Yes	Ramp Slope (%)	5.5	N/A	Grade Break XSlope (%)	0.4
Yes	Ramp XSlope (%)	1.3			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	64.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	57.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.5	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	4.5
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	30.5
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.7
N/A	Painted X Walk1?	No		Road Slope (%)	2.9
	X Walk 1 Direction	To NW		Road X Slope (%)	2.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.9	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	20.3

Total Cost: \$ 2350.00

