

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10022918	Main Street: CEDAR_CROFT_DR	Cross Street: N/A	Location: S
ADA ID: 4FC9F15B6381	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

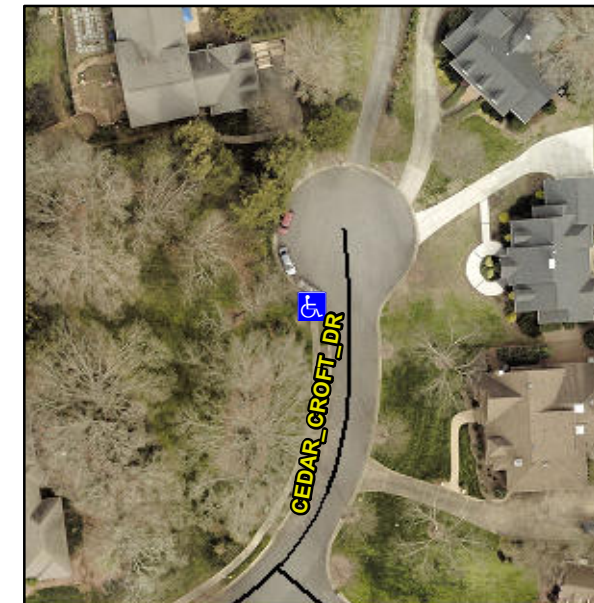

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

ASP LIP 0.5

PROW/ADA:

Not Found, R304.5.3, R304.2.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	29.0	Yes	BlendTrans Slope (%)	2.1
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	2.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
No	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	25.0
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	8.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8		Clear Space?	Yes
	Road X Slope (%)	8.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	14.2

Street 1 Name CEDAR CROFT DR

Stop Condition-Street 1 None

Street 2 Name N/A

Stop Condition-Street 2 N/A

