


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28003	Main Street: COMMUNITY_HOUSE_RD	Cross Street: WILLOW_ROCK_DR	Location: SE
ADA ID: 4FEB0BBF3F7A	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

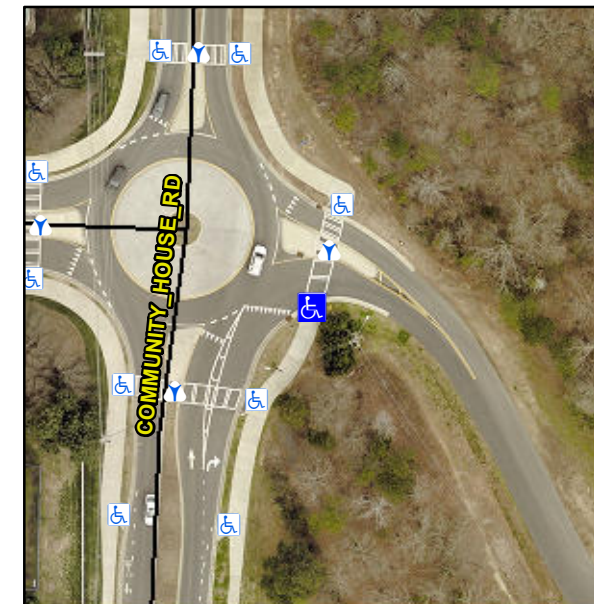

Possible Solutions:

Remove & Replace Curb Slope and Extend Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3

Total Cost: \$ 2750.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.0	Yes	BlendTrans Slope (%)	2.3
Yes	Ramp Width (in)	116.0	Yes	BlendTrans XSlope (%)	0.0
Yes	Flare Type L	Curbed_NoWalkSurface	Yes	Flare Type R	Curbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.7
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	105.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.0		Clear Space?	Yes
	Road X Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	5.1

Street 1 Name **WILLOW ROCK DR**

Stop Condition-Street 1 **YieldSign**

Street 2 Name **N/A**

Stop Condition-Street 2 **N/A**

