

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: GREY_SQUIRREL_CT	Cross Street: WILLOW_TREE_LN	Location: E
ADA ID: 50E82A6706FE	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 15	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

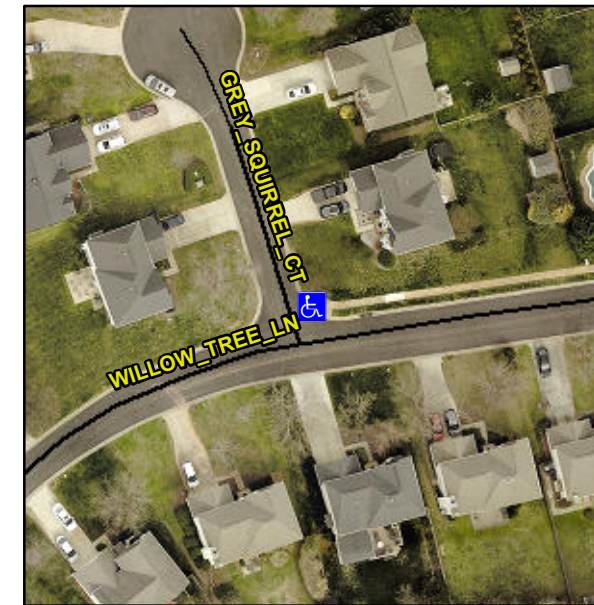

Possible Solutions:

**Install Detectable Warning System.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R305, R304.5.4**

Total Cost: \$ 985.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	BlendTrans Slope (%)	2.8
Yes	Ramp Width (in)	69.0	Yes	BlendTrans XSlope (%)	0.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.7	N/A	Flare Slope RT (%)	2.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	No	DWS Provided?	No
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	12.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.3		X Walk 2 Slope (%)	2.3
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	1.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6		Clear Space?	Yes
	Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	2.1

Street 1 Name GREY SQUIRREL CT  
 Stop Condition-Street 1 StopSign  
 Street 2 Name WILLOW TREE LN  
 Stop Condition-Street 2 None

