
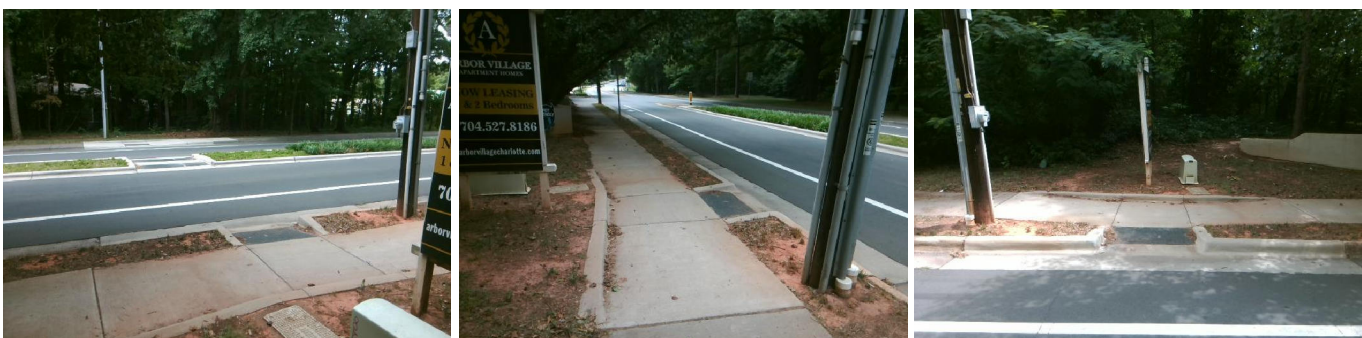


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10037388	Main Street: SCALEYBARK_RD	Cross Street: N/A	Location: NE
ADA ID: 5123DA43B2E4	Ramp Type: Combination2	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	81.0
			Yes	Ramp Width LT (in)	58.0
			Yes	Ramp Slope LT (%)	7.6
			No	Ramp XSlope LT (%)	3.6
			N/A	Ramp Length (in)	24.0
			Yes	Ramp Width (in)	48.0
	Surveyor Notes:		N/A	Flare Type LT	N/A
	N/A		N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
	PROW/ADA:		N/A	Landing Length (in)	N/A
	Not Found, R304.2.2, R304.5.3		N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To SW
<div> <div>Street 1 Name</div> <div>None</div> </div> <div> <div>Stop Condition-Street 1</div> <div>SCALEYBARK RD</div> </div> <div> <div>Street 2 Name</div> <div>N/A</div> </div> <div> <div>Stop Condition-Street 2</div> <div>N/A</div> </div>	Total Cost:	\$ 1600.00	N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	4.6
				X Walk 1 X Slope (%)	2.2
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
				Road X Slope (%)	N/A
			N/A	Ramp inside XWalk2?	N/A
				Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
					N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
					N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	12.3