


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 20640	Main Street: S_TRYON_ST	Cross Street: YAGER_CREEK_DR	Location: W
ADA ID: 518C3741F29E	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 27.75			

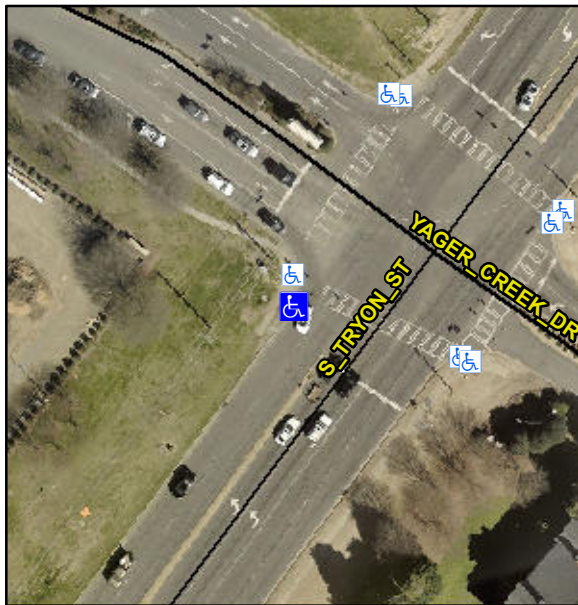

Possible Solutions:

**Remove & Replace Entire Ramp.  
Restripe Crosswalk.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.1,  
R304.2.2-Perp, R304.3.2-Para, R305,  
R207.1, R302.7.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102.0	Yes	Ramp Slope (%)	6.2
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	9.6	Yes	Flare Slope RT (%)	6.3
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	2.8
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	110.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.8		X Walk 2 X Slope (%)	N/A
No	Ramp inside XWalk1?	No	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 2050.00

