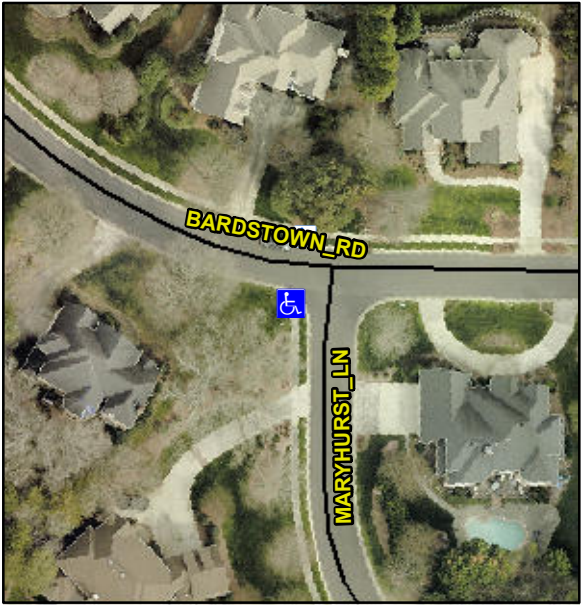


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 24497	Main Street: BARDSTOWN_RD	Cross Street: MARYHURST_LN	Location: SW
ADA ID: 51BEF28FB6A9	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
 Street 1 Name MARYHURST LN Stop Condition-Street 2 StopSign Street 2 Name BARDSTOWN RD Stop Condition-Street 1 None	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Yes	Ramp Length (in)	96.0
			No	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
			To E	X Walk 1 Direction	To N
			N/A	X Walk 1 Width (in)	N/A
			1.9	X Walk 1 Slope (%)	7.1
			5.7	X Walk 1 X Slope (%)	0.5
			N/A	Ramp inside XWalk1?	N/A
			5.4	Road Slope (%)	N/A
			5.1	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	N/A
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Total Cost: \$ 3200.00

