

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29718	Main Street: FALLS LAKE DR	Cross Street: RAVEN ROCK CT	Location: W
ADA ID: 51C824A2F381	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

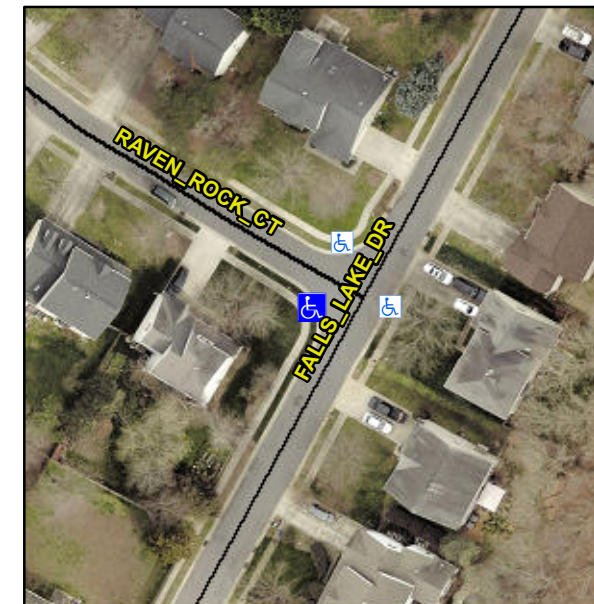

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4

Street 1 Name	FALLS LAKE DR
Stop Condition-Street 1	None
Street 2 Name	RAVEN ROCK CT
Stop Condition-Street 2	StopSign

Total Cost: \$ **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	BlendTrans Slope (%)	3.8
Yes	Ramp Width (in)	50.0	Yes	BlendTrans XSlope (%)	0.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.4	N/A	Flare Slope RT (%)	4.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
Yes	Landing Width (in)	50.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.2	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.7	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	8.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	4.9
	X Walk 1 X Slope (%)	5.7		X Walk 2 X Slope (%)	2.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.9		Clear Space?	Yes
	Road X Slope (%)	5.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	2.7

