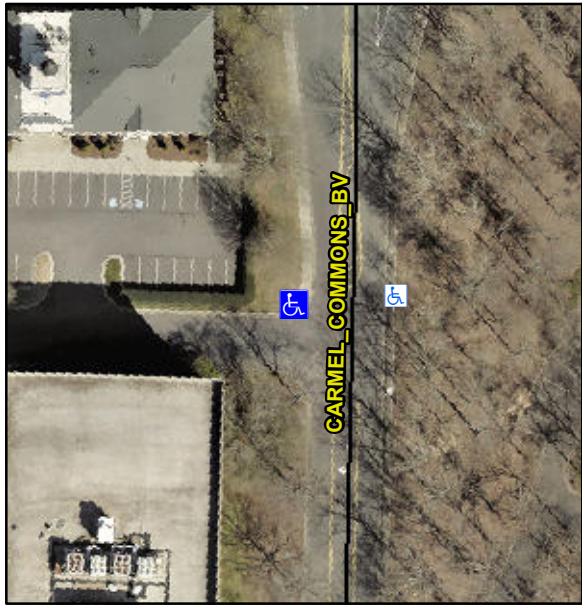


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10022558	Main Street: CARMEL_COMMONS_BV	Cross Street: N/A	Location: NW
ADA ID: 5213032456BB	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 36.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		Compliance		Description		Data	Compliance		Description		Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	73.5	Yes	Ramp Slope (%)	7.1				
			No	Ramp Width (in)	31.0	No	Ramp XSlope (%)	2.4				
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A				
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A				
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A				
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A				
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A				
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A				
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A				
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A				
			N/A	Shared Landing?	N/A							
PROW/ADA:			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A				
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A				
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No				
				X Walk 1 Direction	To S		X Walk 2 Direction	To E				
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A				
				X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	1.5				
				X Walk 1 X Slope (%)	5.0		X Walk 2 X Slope (%)	0.3				
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A				
				Road Slope (%)	1.6	N/A	Clear Space?	N/A				
				Road X Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A				
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A				
				Obstruction Type			Storm Grate/Utility Type					
						N/A						N/A
							Yes	Surface Condition? (G/P)	Good			

