

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5514	Main Street: SUNSET_RD	Cross Street: MILHAVEN_LN	Location: NW
ADA ID: 523690302FEC	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

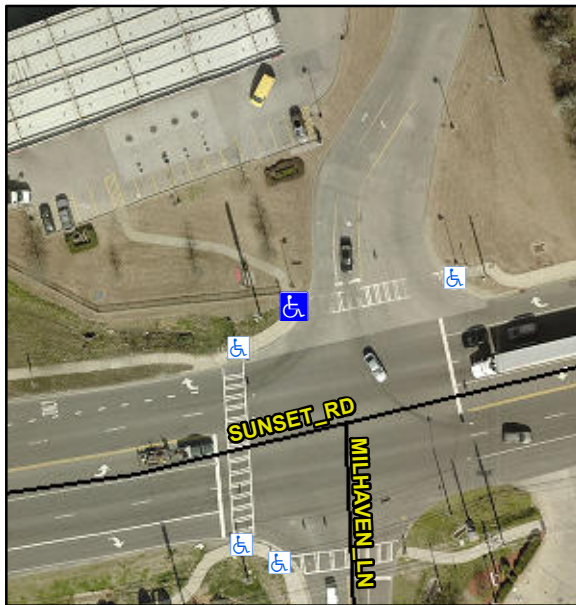

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4, R305.2

Street 1 Name	MILHAVEN LN
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	93.0	N/A	Ramp Length RT (in)	N/A
Yes	Ramp Width LT (in)	58.0	N/A	Ramp Width RT (in)	N/A
Yes	Ramp Slope LT (%)	7.3	N/A	Ramp Slope RT (%)	N/A
Yes	Ramp XSlope LT (%)	0.8	N/A	Ramp XSlope RT (%)	N/A
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	106.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

