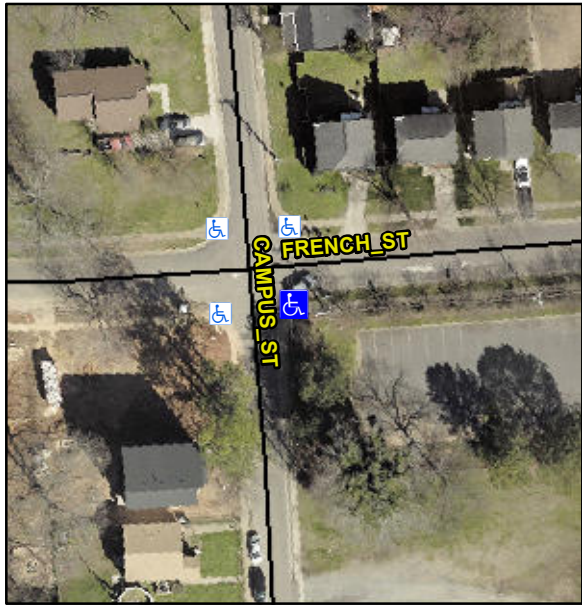


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9973	Main Street: CAMPUS_ST	Cross Street: FRENCH_ST	Location: SE
ADA ID: 52379BCE056D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 12.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:							
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.							
	Surveyor Notes:							
	N/A							
	PROW/ADA:							
	Not Found, R304.2.2							
	Street 1 Name	FRENCH ST	Compliance	Description	Data	Compliance	Description	Data
	Stop Condition-Street 2	StopSign	N/A	Ramp Length (in)	73.0	No	Ramp Slope (%)	9.3
	Street 2 Name	CAMPUS ST	Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.1
	Stop Condition-Street 1	None	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To N		X Walk 2 Direction	To W	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	1.2	
			X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	0.9	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	1.0	N/A	Clear Space?	N/A	
			Road X Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	3200.00					

