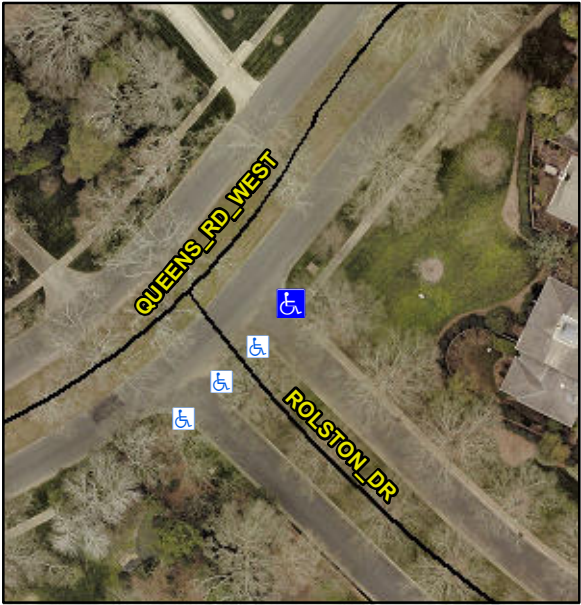


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 15813	Main Street: QUEENS_RD_WEST	Cross Street: ROLSTON_DR	Location: NE
ADA ID: 5281914A74D2	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		Compliance		Description		Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		38.0	N/A	Grade Break?	N/A
<p>Surveyor Notes:</p> <p>N/A</p>	PROW/ADA:		N/A		Ramp Width (in)		48.0	N/A	Grade Break Slope (%)	0.0
	R304.2.2, R304.5.3		N/A		Ramp Slope (%)		9.5	N/A	Grade Break XSlope (%)	0.0
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p>	Total Cost:		\$	1600.00	Ramp XSlope (%)		5.0	N/A	Flare Type RT	N/A
					Flare Type LT		N/A	N/A	Flare Slope RT (%)	0.0
					Flare Slope LT (%)		N/A	N/A	Flare Traversable RT?	N/A
					Flare Traversable LT?		N/A	N/A	DWS Provided?	N/A
					Landing Length (in)		0.0	N/A	DWS Contrast?	N/A
					Landing Width (in)		0.0	N/A	DWS Length (in)	N/A
					Landing Slope (%)		0.0	N/A	DWS Full Width?	N/A
					Landing X Slope (%)		0.0	N/A	DWS Offset LT (in)	N/A
					Landing Curb? (Y/N)		N/A	N/A	DWS Offset RT (in)	N/A
					Shared Landing?		N/A	N/A	Gutter Slope (%)	N/A
					Gutter Ponding?		0.0	N/A	Gutter X Slope (%)	N/A
					Gutter Lip Ht (in)		2.0	N/A	Road Slope (%)	1.6
					Painted X Walk1?		No		Road X Slope (%)	2.8
					X Walk 1 Direction	To SW			Clear Space?	N/A
					X Walk 1 Width (in)		N/A		Clear Space to XWalk (in)	N/A
					X Walk 1 Slope (%)		1.6	N/A	Storm Grate/Utility Hazard?	N/A
					X Walk 1 X Slope (%)		2.8	N/A	Storm Grate/Utility Type	
					Ramp inside XWalk1?		N/A		Surface Condition? (G/P)	Good
					Any Obstructions?		N/A		Curb Slope (%)	24.1
					Obstruction Type					

