


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 10040584		Main Street: W_ARROWWOOD_RD		Cross Street: N/A		Location:		SW	
ADA ID: 5321F5F1864D		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 2.5	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
 Possible Solutions: Remove & Replace Entire Ramp. Remove & Replace Gutter. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.2, R305.1.4, R304.5.3 Street 1 NameENTRANCE Stop Condition-Street 1StopSign Street 2 NameN/A Stop Condition-Street 2N/A Total Cost:\$2350.00				Compliance	Description	Data	Compliance	Description	Data
				N/A	Ramp Length (in)	21.0	No	Grade Break?	No
				Yes	Ramp Width (in)	60.0	N/A	Grade Break Slope (%)	2.1
				Yes	Ramp Slope (%)	6.6	N/A	Grade Break XSlope (%)	3.1
				Yes	Ramp XSlope (%)	1.5			
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	7.4	N/A	Flare Slope RT (%)	5.0
				N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
				Yes	Landing Length (in)	65.0	Yes	DWS Provided?	Yes
				Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
				No	Landing Slope (%)	3.6	Yes	DWS Length (in)	24.0
				Yes	Landing X Slope (%)	1.2	No	DWS Full Width?	No
				N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	0.0
				N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.0
				Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.2
				N/A	Painted X Walk1?	No		Road Slope (%)	2.4
					X Walk 1 Direction	To NE		Road X Slope (%)	2.1
					X Walk 1 Width (in)	N/A		Clear Space?	Yes
					X Walk 1 Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A
					X Walk 1 X Slope (%)	2.1	Yes	Storm Grate/Utility Hazard?	No
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
				Yes	Any Obstructions?	No			N/A
					Obstruction Type		Yes	Surface Condition? (G/P)	Good
							N/A	Curb Slope (%)	18.1

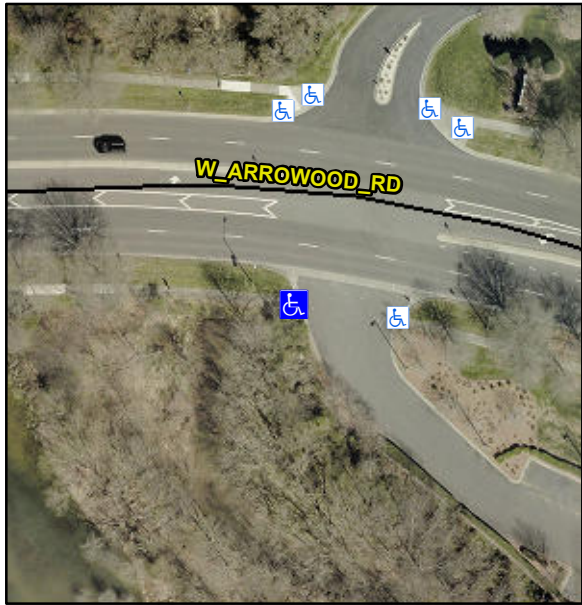